


## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 46708Main Street:REA\_RDCross Street:BLAKENEY\_PROFESSIONAL\_DRLocation:WADA ID: C8228C15BA4FRamp Type:BlendTrans2Initial Pass/Fail:FailOverall Compliance:NoSeverity Score:10

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

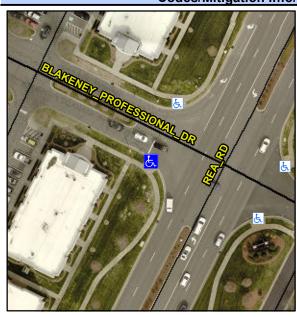

Street 1 Name REA RD
Stop Condition-Street 1 None
Street 2 Name BLAKENEY PROFESSIONAL DR
Stop Condition-Street 2 StopSign

Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.5.3

Total Cost: \$ 3200.00

Compliance Description Data Compliance Description Data					
N/A Ramp Length (in)		144.0	Yes BlendTrans Slope (%)		4.0
N/A No	. • ,	45.0	nes No		2.3
	Ramp Width (in)			BlendTrans XSlope (%)	
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.1		X Walk 2 Slope (%)	0.1
	X Walk 1 X Slope (%)	1.2		X Walk 2 X Slope (%)	1.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.3		Clear Space?	N/A
	Road X Slope (%)	2.8	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type		l	Storm Grate/Utility Type	
		N/A	l		N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	7.1
		'	-		





