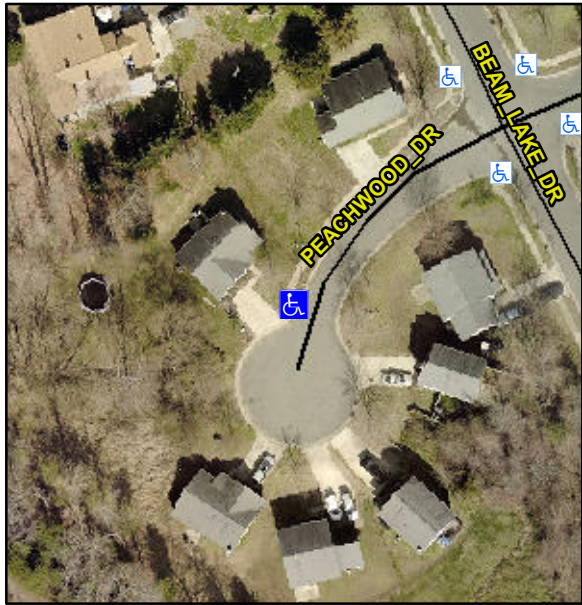


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10034219	Main Street: PEACHWOOD_DR	Cross Street: N/A	Location:	N
ADA ID: C8D1138975CA	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 10.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.2
	Remove & Replace Gutter.		Yes	Ramp Width (in)	77.0	No	Ramp XSlope (%)	2.5
			N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			No	Landing Length (in)	46.0	No	DWS Provided?	No
			Yes	Landing Width (in)	77.0	N/A	DWS Contrast?	No
			Yes	Landing Slope (%)	1.6	N/A	DWS Length (in)	N/A
			No	Landing X Slope (%)	3.0	N/A	DWS Full Width?	No
Surveyor Notes:  N/A   PROW/ADA:  Not Found, R304.5.3, R304.2.1, R305		N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A	
		N/A	Shared Landing?	No				
		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.8	
		Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	7.9	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
			X Walk 1 Direction	To E		X Walk 2 Direction	N/A	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	6.0		X Walk 2 Slope (%)	N/A	
			X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	N/A	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	N/A	N/A	Clear Space?	Yes	
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
					N/A		N/A	
					Yes	Surface Condition? (G/P)	Good	

