


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 42788 Main Street: CRUTCHFIELD_PL Cross Street: SIDNEY_CREST_AV Location: E

ADA ID: C91660E9E409 Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 21.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

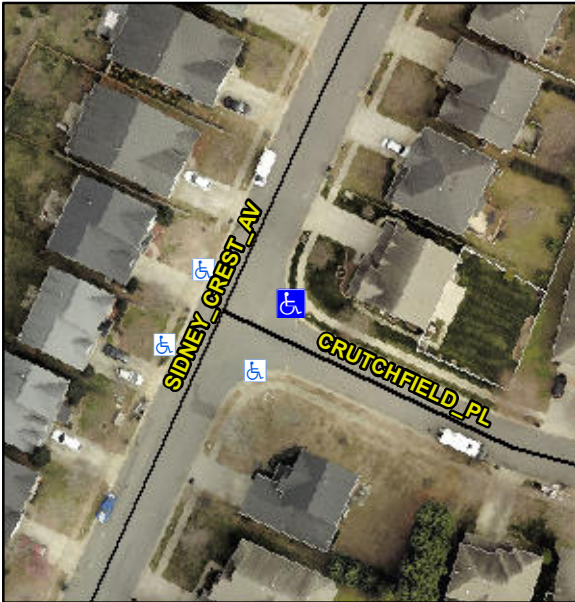

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.1, R304.2.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	53.5	No	Ramp Slope (%)	11.0
No	Ramp Width (in)	45.0	Yes	Ramp XSlope (%)	1.9
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	9.0		X Walk 2 Slope (%)	10.9
	X Walk 1 X Slope (%)	8.3		X Walk 2 X Slope (%)	3.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.8	N/A	Clear Space?	N/A
	Road X Slope (%)	10.2	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
Yes	Surface Condition? (G/P)				Good



Street 1 Name **SIDNEY CREST AV**
 Stop Condition-Street 2 **None**
 Street 2 Name **CRUTCHFIELD PL**
 Stop Condition-Street 1 **StopSign**