


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 25958 Main Street: KINGFISHER_DR Cross Street: PARK_RD Location: NE

ADA ID: C95F467BF11F Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 33.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

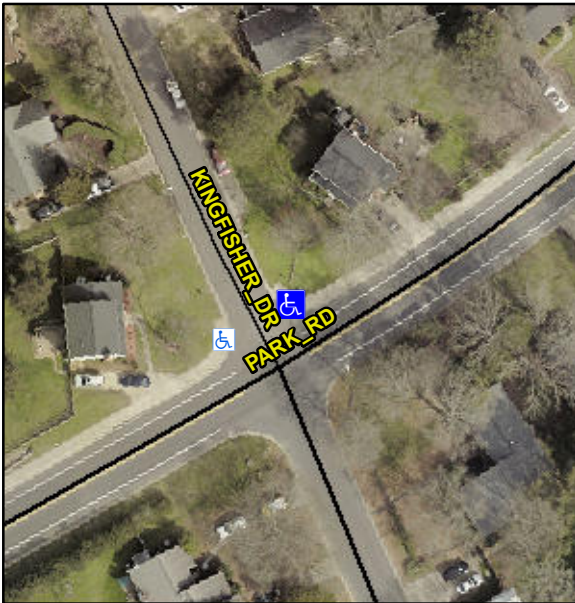

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R304.5.1, R304.5.3

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|------|------------|-----------------------------|------|
| N/A | Ramp Length (in) | 70.0 | Yes | Ramp Slope (%) | 7.3 |
| No | Ramp Width (in) | 47.0 | No | Ramp XSlope (%) | 7.9 |
| N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | N/A | N/A | Flare Traversable RT? | N/A |
| N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A |
| N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A |
| N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A |
| N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A |
| N/A | Shared Landing? | N/A | | | |
| N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A |
| N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | No |
| | X Walk 1 Direction | To W | | X Walk 2 Direction | To S |
| N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 5.4 | | X Walk 2 Slope (%) | 2.0 |
| | X Walk 1 X Slope (%) | 3.1 | | X Walk 2 X Slope (%) | 7.1 |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 5.9 | N/A | Clear Space? | N/A |
| | Road X Slope (%) | 4.3 | N/A | Clear Space to XWalk (in) | N/A |
| N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | | N/A | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |

Total Cost: \$ 3200.00

Street 1 Name **KINGFISHER DR**
 Stop Condition-Street 2 **StopSign**
 Street 2 Name **PARK RD**
 Stop Condition-Street 1 **None**

