


Intersection ID: 8303	Main Street: IRMA_ST	Cross Street: CATHERINE_SIMMONS_AV	Location:	SE
ADA ID: CA311D63B1B9	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 15.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

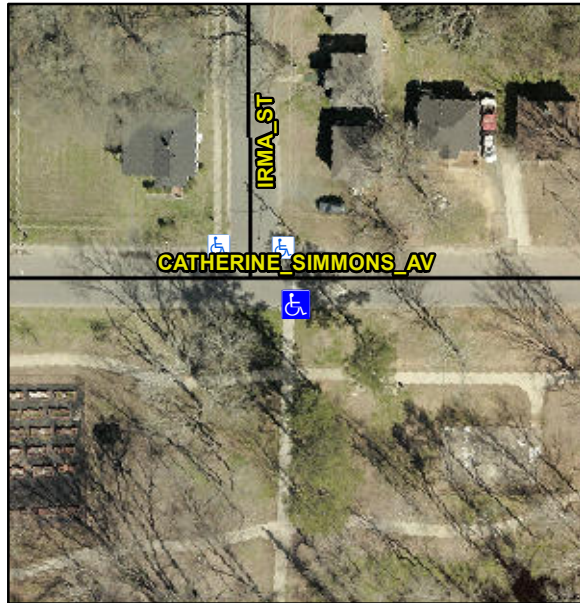

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.5.3, R304.2.1,
R304.2.2-Perp, R304.3.2-Para,
R302.7, R304.5.4**

Street 1 Name	CATHERINE SIMMONS AV
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost: \$ 2600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	70.0	Yes	Ramp Slope (%)	6.3
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	31.3	N/A	Flare Slope RT (%)	29.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.5
No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	8.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

