


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 28770	Main Street: BALDWIN_HALL_DR	Cross Street: GEORGIAN_HALL_DR	Location: NW
ADA ID: CB190A32E2BC	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 22.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

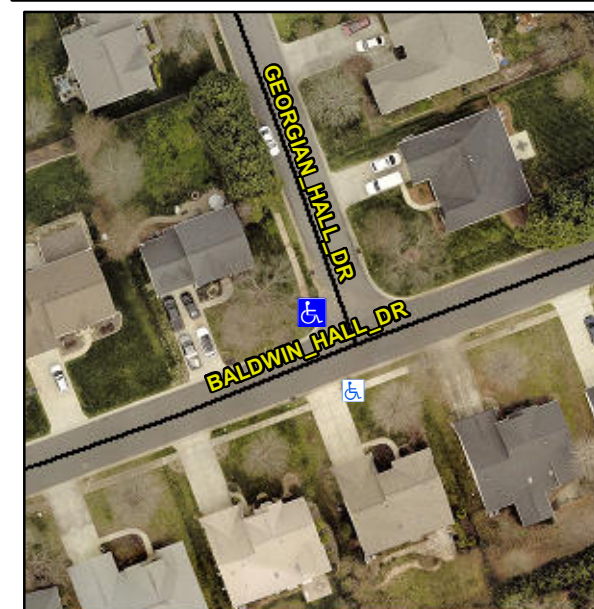

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R305, R302.7.2, R304.5.4**

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	42.0	Yes	BlendTrans Slope (%)	3.9
Yes	Ramp Width (in)	51.0	Yes	BlendTrans XSlope (%)	3.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	7.7	N/A	Flare Slope RT (%)	1.1
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	No	DWS Provided?	No
Yes	Landing Width (in)	51.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	0.7	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	2.4	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	10.1
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	2.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	5.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	5.9		Clear Space?	Yes
	Road X Slope (%)	0.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	17.0

Street 1 Name	BALDWIN HALL DR
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

