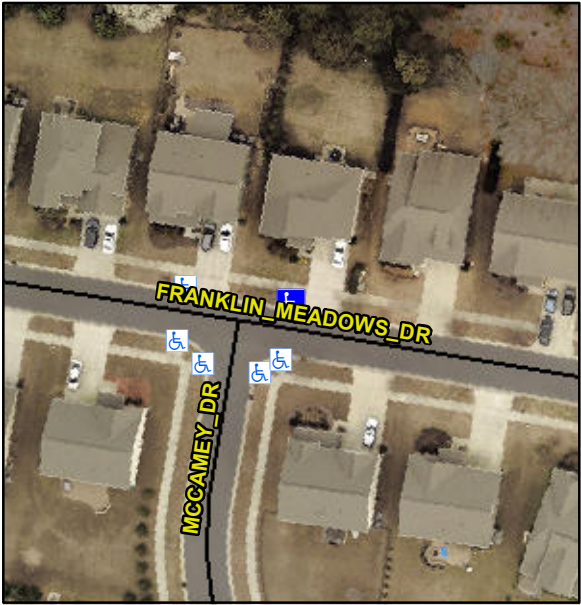


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 48147	Main Street: MCCAMEY_DR	Cross Street: FRANKLIN_MEADOWS_DR	Location: NE
ADA ID: CB2C66B7B805	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.75	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		Yes	Ramp Length (in)	94.5
			No	Ramp Width (in)	54.5
			Sloped	Flare Type LT	N/A
			Yes	Flare Slope LT (%)	4.9
			Yes	Flare Traversable LT?	Yes
			Yes	Landing Length (in)	60.0
			Yes	Landing Width (in)	54.5
			Yes	Landing Slope (%)	1.5
			No	Landing X Slope (%)	1.2
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.3, R305.1.4, R305.2</p>			No	Landing Curb? (Y/N)	No
			No	Shared Landing?	No
			No	Gutter Ponding?	No
			Yes	Gutter Lip Ht (in)	0.0
			No	Painted X Walk1?	No
				X Walk 1 Direction	To S
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	3.6
				X Walk 1 X Slope (%)	0.5
			N/A	Ramp inside XWalk1?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			Yes	Any Obstructions?	No
				Obstruction Type	
			N/A		
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 1850.00

