

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 7615 Main Street: ECHO_GLEN_RD Cross Street: VALEN_WY Location: W

ADA ID: CB56F3A6CF90 Ramp Type: Directional1 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 21.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

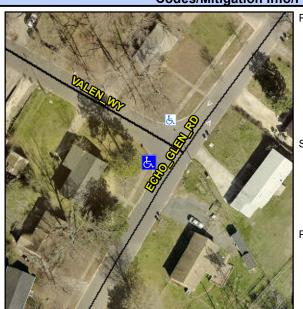

Street 1 Name
VALEN WY
Stop Condition-Street 1
StopSign
Street 2 Name
N/A
Stop Condition-Street 2
N/A

Total Cost: \$ 1600.00

Field Measurements/Component Compliance					
Compl	iance Description	Data	Comp	liance Description	Data
N/A	Ramp Length (in)	43.0	N/A	Grade Break?	N/A
No	Ramp Width (in)	43.0	N/A	Grade Break Slope (%)	0.0
No	Ramp Slope (%)	9.1	N/A	Grade Break XSlope (%)	0.0
Yes	Ramp XSlope (%)	1.2			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	0.5	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No		Road Slope (%)	0.1
	X Walk 1 Direction	To NE		Road X Slope (%)	2.6
	X Walk 1 Width (in)	N/A		Clear Space?	N/A
	X Walk 1 Slope (%)	0.1	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.6	N/A	Storm Grate/Utility Hazard?	N/A
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
N/A	Any Obstructions?	N/A			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
		N/A	N/A	Curb Slope (%)	22.3





