


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12577	Main Street: SEIGLE_AV	Cross Street: GREEN_TRAIL_LN	Location:	N
ADA ID: CB74AAC3C1C3	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

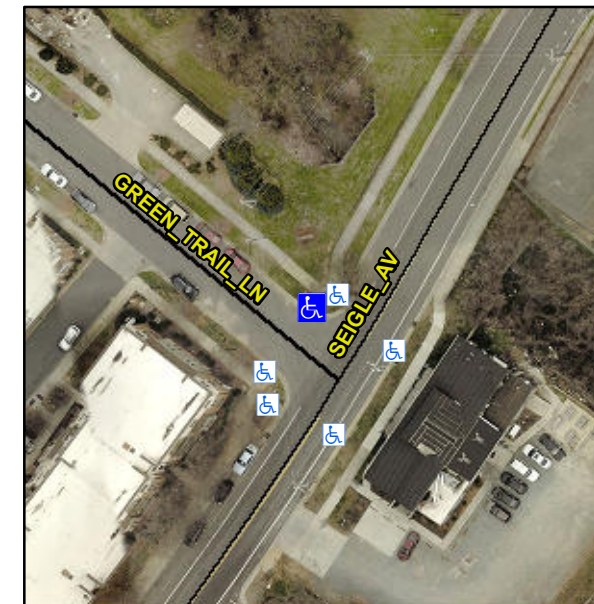

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305.2

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	83.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	69.0	No	Grade Break Slope (%)	5.4
Yes	Ramp Slope (%)	5.7	Yes	Grade Break XSlope (%)	0.1
Yes	Ramp XSlope (%)	0.8			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	68.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	77.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.3	Yes	DWS Length (in)	25.0
No	Landing X Slope (%)	3.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	16.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	8.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.6
N/A	Painted X Walk1?	No		Road Slope (%)	1.4
	X Walk 1 Direction	To SW		Road X Slope (%)	2.1
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	1.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.1	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	9.2

