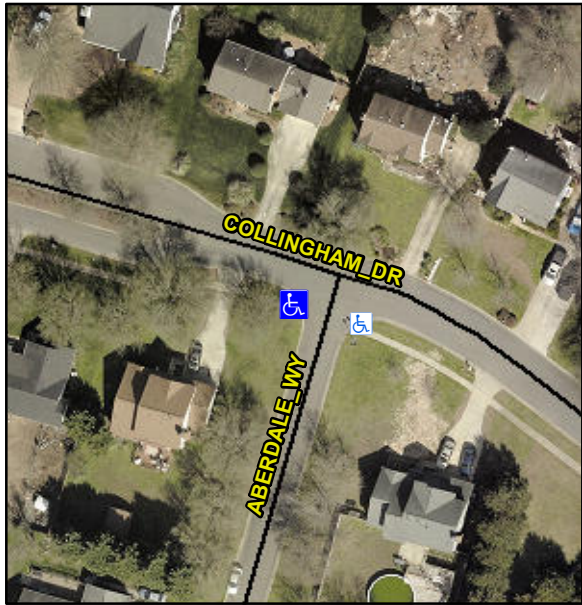


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 20181	Main Street: ABERDALE_WY	Cross Street: COLLINGHAM_DR	Location: SW
ADA ID: CBABB93AEE7F	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance			Description			Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	40.0	N/A	Grade Break?	N/A		
			No	Ramp Width (in)	44.0	N/A	Grade Break Slope (%)	0.0		
			No	Ramp Slope (%)	8.8	N/A	Grade Break XSlope (%)	0.0		
			Yes	Ramp XSlope (%)	0.5					
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0		
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
			N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A		
			N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A		
		N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A			
		N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A			
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A			
		N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A			
		N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A			
		N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A			
		N/A	Painted X Walk1?	No		Road Slope (%)	2.4			
			X Walk 1 Direction	To E		Road X Slope (%)	5.0			
			X Walk 1 Width (in)	N/A		Clear Space?	N/A			
			X Walk 1 Slope (%)	2.4	N/A	Clear Space to XWalk (in)	N/A			
			X Walk 1 X Slope (%)	5.0	N/A	Storm Grate/Utility Hazard?	N/A			
		N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type				
		N/A	Any Obstructions?	N/A			N/A			
			Obstruction Type		Yes	Surface Condition? (G/P)	Good			
					N/A	Curb Slope (%)	14.6			
			</							

Street 1 Name	ABERDALE WY
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1600.00

