


Intersection ID: 17851	Main Street: SCALEYBARK_RD	Cross Street: BROOKRUN_DR	Location:	NW
ADA ID: CBF8F94463EA	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

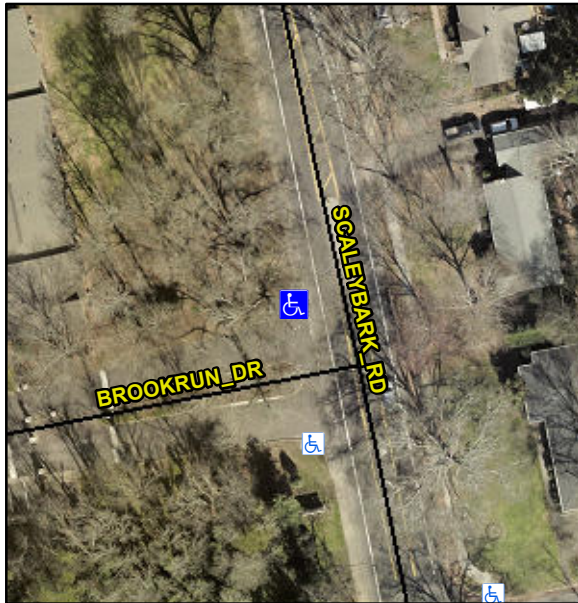

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.5.3

Compliance		Description	Data	Compliance		Description	Data
N/A		Ramp Length LT (in)	N/A	N/A		Ramp Length RT (in)	49.0
N/A		Ramp Width LT (in)	N/A	Yes		Ramp Width RT (in)	59.0
N/A		Ramp Slope LT (%)	N/A	Yes		Ramp Slope RT (%)	7.0
N/A		Ramp XSlope LT (%)	N/A	Yes		Ramp XSlope RT (%)	0.8
No		Landing Length (in)	58.0	Yes		DWS Provided?	Yes
Yes		Landing Width (in)	48.0	Yes		DWS Contrast?	Yes
Yes		Landing Slope (%)	0.6	Yes		DWS Length (in)	24.5
No		Landing X Slope (%)	3.6	Yes		DWS Full Width?	Yes
N/A		Landing Curb? (Y/N)	Yes	Yes		DWS Offset (in)	2.0
N/A		Shared Landing?	No				
Yes		Gutter Ponding?	No	Yes		Gutter Slope (%)	4.6
Yes		Gutter Lip Ht (in)	0.0	No		Gutter X Slope (%)	2.7
N/A		Painted X Walk1?	No	N/A		Painted X Walk2?	No
		X Walk 1 Direction	To S			X Walk 2 Direction	To E
N/A		X Walk 1 Width (in)	N/A	N/A		X Walk 2 Width (in)	N/A
		X Walk 1 Slope (%)	1.3			X Walk 2 Slope (%)	4.3
		X Walk 1 X Slope (%)	2.3			X Walk 2 X Slope (%)	1.1
N/A		Ramp inside XWalk1?	N/A	N/A		Ramp inside XWalk2?	N/A
		Road Slope (%)	0.3	N/A		Clear Space?	Yes
		Road X Slope (%)	5.2	N/A		Clear Space to XWalk (in)	N/A
Yes		Any Obstructions?	No	Yes		Storm Grate/Utility Hazard?	No
		Obstruction Type				Storm Grate/Utility Type	
			N/A				N/A
				Yes		Surface Condition? (G/P)	Good
				N/A		Curb Slope (%)	7.2

Total Cost: \$ 3950.00

