


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 49248	Main Street: BOOMERANG_WY	Cross Street: PROSPERITY_VIEW_DR	Location: SE
ADA ID: CC0FAEED7C53	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

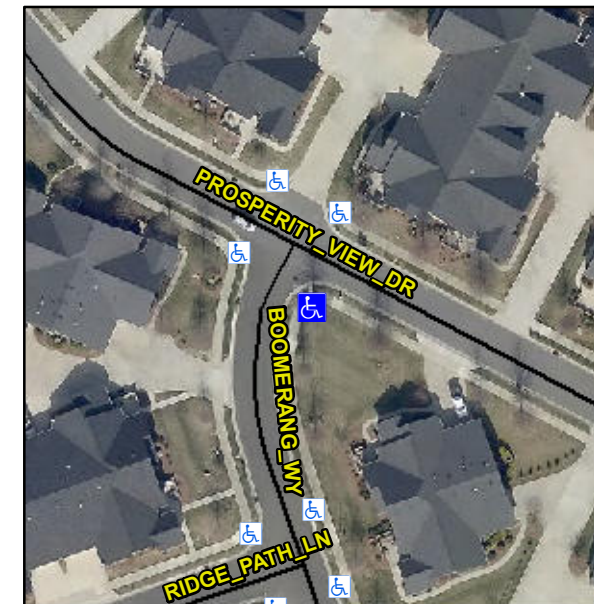

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	53.0	Yes	BlendTrans Slope (%)	2.3
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	1.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	7.6	N/A	Flare Slope RT (%)	6.7
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	54.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	50.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.6	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	6.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To W
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.3		X Walk 2 Slope (%)	2.8
	X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	0.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.5		Clear Space?	Yes
	Road X Slope (%)	2.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	10.3

Street 1 Name PROSPERITY VIEW DR
 Stop Condition-Street 1 None
 Street 2 Name BOOMERANG WY
 Stop Condition-Street 2 StopSign

