


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10074	Main Street: KILDARE_DR	Cross Street: OLINDA_ST	Location:	N
ADA ID: CC96538A3007	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 15
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

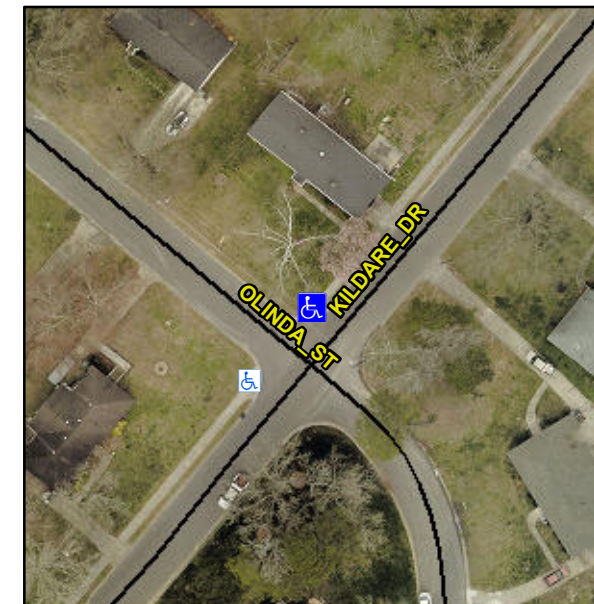

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-
Para, R305.1.4, R305.2, R302.7.2,
R304.5.4**

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	160.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	60.0	Yes	Grade Break Slope (%)	4.7
Yes	Ramp Slope (%)	2.8	Yes	Grade Break XSlope (%)	1.9
Yes	Ramp XSlope (%)	1.3			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	4.7	Yes	Flare Slope RT (%)	9.4
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	70.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.1	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	3.0	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	60.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	5.0
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.7
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	3.5
N/A	Painted X Walk1?	No		Road Slope (%)	2.3
	X Walk 1 Direction	To SW		Road X Slope (%)	3.8
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.3	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	3.8	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	16.0

