


# Access Compliance Report Public Rights-of-Way (Curb Ramps)

|                        |                         |                           |   |
|------------------------|-------------------------|---------------------------|---|
| Intersection ID: 10247 | Main Street: BURTON_ST  | Cross Street: WHISNANT_ST | Location: NE                                    |
| ADA ID: CD44BAAFDD82   | Ramp Type: Combination2 | Initial Pass/Fail: Fail   | Overall Compliance: No<br>Severity Score: 36.25 |

### Codes/Mitigation Info/Possible Solution

### Field Measurements/Component Compliance

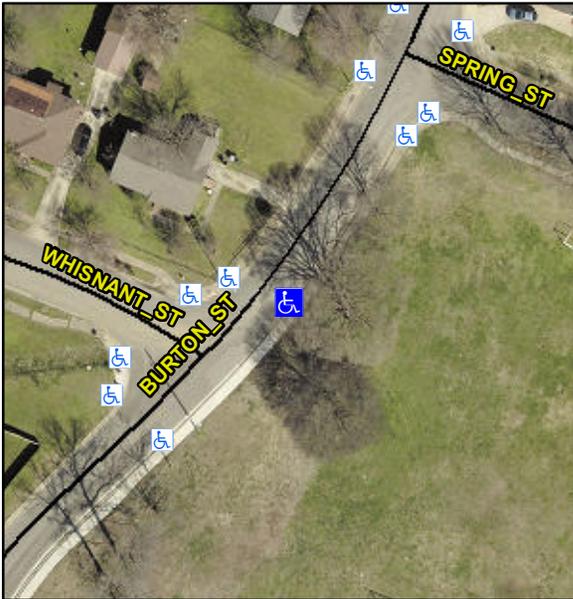

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**RT RP < 5%**

PROW/ADA:

**Not Found, R304.5.1, R304.5.1, R304.5.3**

|                         |           |
|-------------------------|-----------|
| Street 1 Name           | None      |
| Stop Condition-Street 1 | BURTON ST |
| Street 2 Name           | N/A       |
| Stop Condition-Street 2 | N/A       |

Total Cost: \$ 1600.00

| Compliance | Description              | Data | Compliance | Description                 | Data |
|------------|--------------------------|------|------------|-----------------------------|------|
| N/A        | Ramp Length LT (in)      | 36.0 | N/A        | Ramp Length RT (in)         | 76.0 |
| No         | Ramp Width LT (in)       | 37.0 | N/A        | Ramp Width RT (in)          | 30.0 |
| Yes        | Ramp Slope LT (%)        | 7.7  | N/A        | Ramp Slope RT (%)           | 2.3  |
| No         | Ramp XSlope LT (%)       | 5.0  | N/A        | Ramp XSlope RT (%)          | 2.3  |
| N/A        | Ramp Length (in)         | 34.0 | Yes        | Ramp Slope (%)              | 7.3  |
| No         | Ramp Width (in)          | 40.0 | Yes        | Ramp XSlope (%)             | 2.9  |
| N/A        | Flare Type LT            | N/A  | N/A        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)       | N/A  | N/A        | Flare Slope RT (%)          | N/A  |
| N/A        | Flare Traversable LT?    | N/A  | N/A        | Flare Traversable RT?       | N/A  |
| N/A        | Landing Length (in)      | N/A  | N/A        | DWS Provided?               | N/A  |
| N/A        | Landing Width (in)       | N/A  | N/A        | DWS Contrast?               | N/A  |
| N/A        | Landing Slope (%)        | N/A  | N/A        | DWS Length (in)             | N/A  |
| N/A        | Landing X Slope (%)      | N/A  | N/A        | DWS Full Width?             | N/A  |
| N/A        | Landing Curb? (Y/N)      | N/A  | N/A        | DWS Offset (in)             | N/A  |
| N/A        | Shared Landing?          | N/A  |            |                             |      |
| N/A        | Gutter Ponding?          | N/A  | N/A        | Gutter Slope (%)            | N/A  |
| N/A        | Gutter Lip Ht (in)       | N/A  | N/A        | Gutter X Slope (%)          | N/A  |
| N/A        | Painted X Walk1?         | No   | N/A        | Painted X Walk2?            | N/A  |
|            | X Walk 1 Direction       | To W |            | X Walk 2 Direction          | N/A  |
|            | X Walk 1 Width (in)      | N/A  |            | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)       | 5.6  |            | X Walk 2 Slope (%)          | N/A  |
|            | X Walk 1 X Slope (%)     | 4.6  |            | X Walk 2 X Slope (%)        | N/A  |
| N/A        | Ramp inside XWalk1?      | N/A  | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)           | N/A  |            | Clear Space?                | N/A  |
|            | Road X Slope (%)         | N/A  | N/A        | Clear Space to XWalk (in)   | N/A  |
|            |                          |      | N/A        | Any Obstruction?            | N/A  |
|            |                          |      |            | Obstruction Type            |      |
|            |                          |      |            |                             | N/A  |
|            |                          |      | N/A        | Storm Grate/Utility Hazard? | N/A  |
|            |                          |      |            | Storm Grate/Utility Type    |      |
|            |                          |      |            |                             | N/A  |
| Yes        | Surface Condition? (G/P) |      |            |                             | Good |
|            | Curb Slope (%)           |      |            |                             | 32.7 |

