


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

| | | | |
|---|----------------------------|---|------------------------|
| Intersection ID: 29375 | Main Street: BUCKVALLEY_DR | Cross Street: ROBANNA_CT | Location: SE |
| ADA ID: CD463D744F08 | Ramp Type: PerpDiag | Initial Pass/Fail: Pass | Overall Compliance: No |
| Severity Score: 0 | | | |
| Codes/Mitigation Info/Possible Solution | | Field Measurements/Component Compliance | |

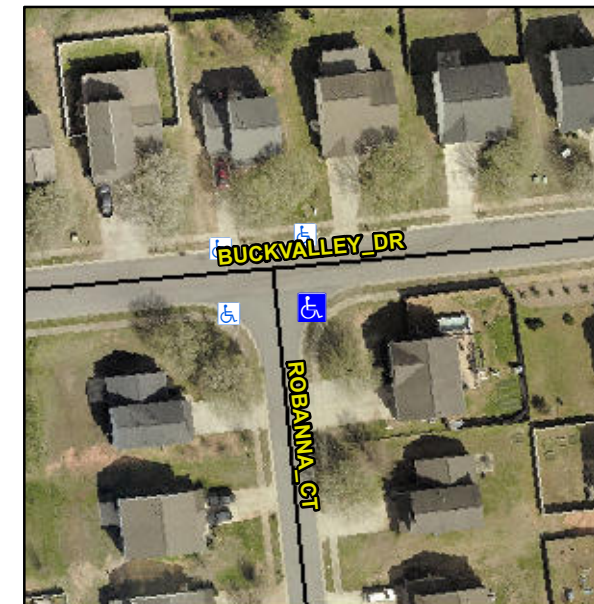

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305.2

Total Cost: \$ 3200.00

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|--------|------------|-----------------------------|------|
| N/A | Ramp Length (in) | 49.5 | Yes | Ramp Slope (%) | 6.3 |
| Yes | Ramp Width (in) | 48.0 | Yes | Ramp XSlope (%) | 1.2 |
| N/A | Flare Type LT | Sloped | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | 2.2 | Yes | Flare Slope RT (%) | 6.9 |
| N/A | Flare Traversable LT? | Yes | N/A | Flare Traversable RT? | Yes |
| No | Landing Length (in) | 44.0 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 48.0 | Yes | DWS Contrast? | Yes |
| No | Landing Slope (%) | 4.6 | Yes | DWS Length (in) | 24.0 |
| No | Landing X Slope (%) | 2.7 | Yes | DWS Full Width? | Yes |
| N/A | Landing Curb? (Y/N) | No | No | DWS Offset (in) | 5.0 |
| N/A | Shared Landing? | No | | | |
| Yes | Gutter Ponding? | No | Yes | Gutter Slope (%) | 0.6 |
| Yes | Gutter Lip Ht (in) | 0.0 | Yes | Gutter X Slope (%) | 1.7 |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | No |
| | X Walk 1 Direction | To N | | X Walk 2 Direction | To W |
| N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 0.7 | | X Walk 2 Slope (%) | 6.2 |
| | X Walk 1 X Slope (%) | 5.0 | | X Walk 2 X Slope (%) | 1.5 |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 2.1 | N/A | Clear Space? | Yes |
| | Road X Slope (%) | 4.8 | N/A | Clear Space to XWalk (in) | N/A |
| Yes | Any Obstructions? | No | Yes | Storm Grate/Utility Hazard? | No |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |

Street 1 Name BUCKVALLEY DR

Stop Condition-Street 2 None

Street 2 Name ROBANNA CT

Stop Condition-Street 1 StopSign

