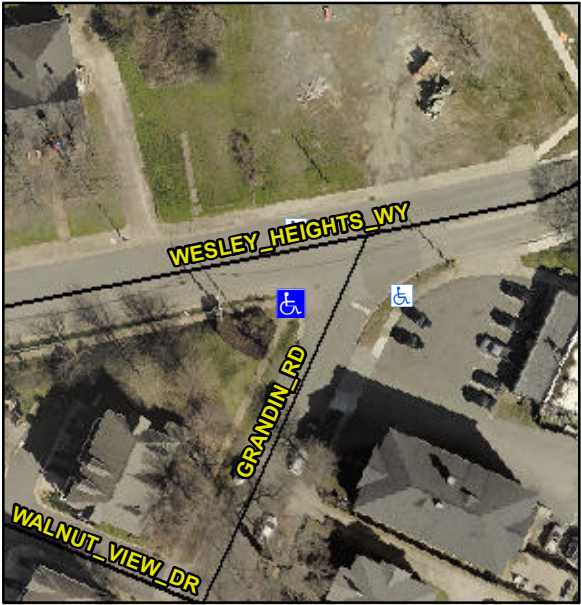


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 11074	Main Street: WESLEY HEIGHTS_WY	Cross Street: GRANDIN_RD	Location: W
ADA ID: CDA271727B0B	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:				
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>				
	Surveyor Notes:				
	<b>N/A</b>				
	PROW/ADA:				
	<b>Not Found, R304.5.1, R304.2.2</b>				
	Street 1 Name	GRANDIN RD			
	Stop Condition-Street 2	StopSign			
	Street 2 Name	WESLEY HEIGHTS WY			
	Stop Condition-Street 1	None			
	Total Cost:	\$ 3200.00			
Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	117.5	No	Ramp Slope (%)	8.9
No	Ramp Width (in)	46.5	Yes	Ramp XSlope (%)	1.7
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	0.5	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To NE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.1		X Walk 2 Slope (%)	0.8
	X Walk 1 X Slope (%)	1.9		X Walk 2 X Slope (%)	0.5
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.8	N/A	Clear Space?	N/A
	Road X Slope (%)	2.0	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

