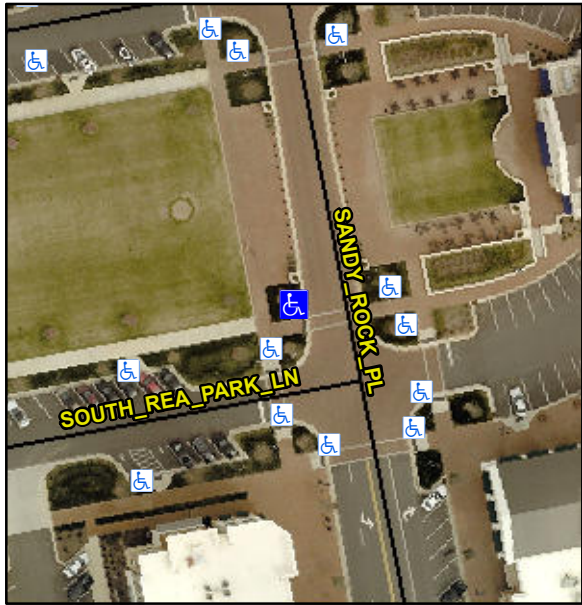


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 54220	Main Street: SOUTH_REA_PARK_LN	Cross Street: SANDY_ROCK_PL	Location: NW
ADA ID: CDF55FBF2770	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 5.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	24.0	Yes	Ramp Slope (%)	5.6
	Remove & Replace Gutter.		Yes	Ramp Width (in)	95.5	No	Ramp XSlope (%)	2.4
			N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			Yes	Landing Length (in)	210.5	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	95.5	Yes	DWS Contrast?	Yes
			No	Landing Slope (%)	2.3	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	2.2	Yes	DWS Full Width?	Yes
Surveyor Notes: N/A PROW/ADA: R304.5.3, R304.2.2-Perp, R304.3.2-Para, R304.5.4			N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
			N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	No	Gutter Slope (%)	7.4
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.0
			N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To E		X Walk 2 Direction	N/A
			N/A	X Walk 1 Width (in)	72.0	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	1.2		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	0.6		X Walk 2 X Slope (%)	N/A
			Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	N/A	N/A	Clear Space?	Yes	
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good

Street 1 Name	SANDY ROCK PL
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

