


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 2755	Main Street: BELL'S_MILL_DR	Cross Street: RIDGEFIELD_DR	Location: E
ADA ID: CE4A431754CB	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 14.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

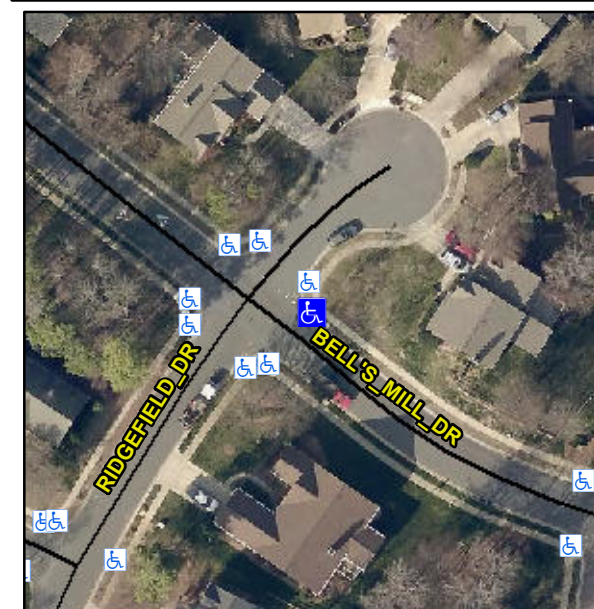

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R304.5.3, R305.1.4, R305.2, R302.7.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	50.0	Yes	BlendTrans Slope (%)	3.2
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	3.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	5.4	N/A	Flare Slope RT (%)	3.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	46.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	43.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.6	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	5.4	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	13.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.1
No	Gutter Lip Ht (in)	0.3	Yes	Gutter X Slope (%)	0.6
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.2		Clear Space?	Yes
	Road X Slope (%)	2.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	8.5

