


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 10020374	Main Street: BALLANTYNE CORPORATE PL	Cross Street: N/A	Location: SE
ADA ID: CE902285C29C	Ramp Type: Directional	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 21.25			

	Possible Solutions:				
	Remove & Replace Entire Ramp.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	R304.5.1, R304.5.3				
	Street 1 Name	ENTRANCE			
	Stop Condition-Street 1	StopSign			
	Street 2 Name	N/A			
	Stop Condition-Street 2	N/A			
Total Cost:		\$ 1600.00			
			Compliance	Description	Data
			N/A	Ramp Length (in)	52.0
			No	Ramp Width (in)	46.0
			Yes	Ramp Slope (%)	3.9
			No	Ramp XSlope (%)	5.3
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	0.0
			N/A	Landing Width (in)	0.0
			N/A	Landing Slope (%)	0.0
			N/A	Landing X Slope (%)	0.0
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	0.0
			N/A	Gutter Lip Ht (in)	0.0
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To NW
				X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	1.7
				X Walk 1 X Slope (%)	7.6
			N/A	Ramp inside XWalk1?	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	7.0

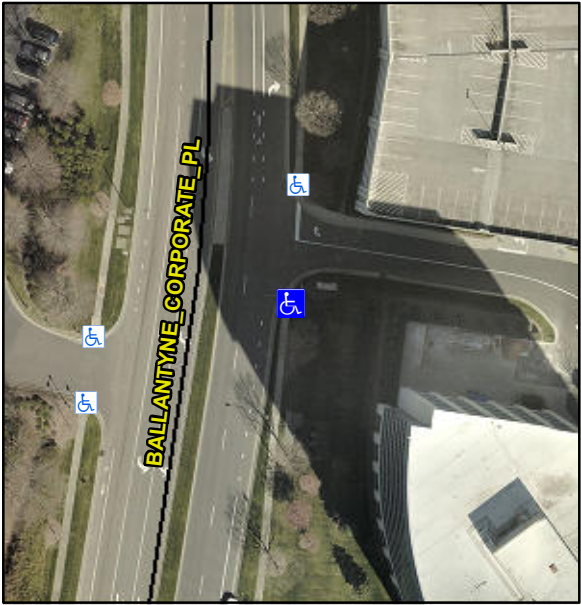