


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 30214	Main Street: HIDDEN_CREEK_DR	Cross Street: MOSS_STREAM_LN	Location:	N
ADA ID: CEF7C6C13055	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 14
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

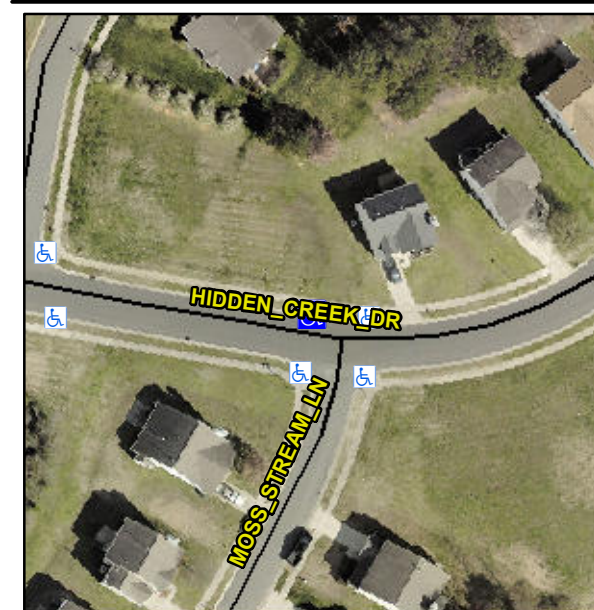

Possible Solutions:

**Remove & Replace Entire Ramp.
Utility Present.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.2.1, R304.2.2-Perp,
R304.3.2-Para, R305, R302.3, R402.2**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.9
Yes	Ramp Width (in)	52.0	Yes	Ramp XSlope (%)	1.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	1.5	N/A	Flare Slope RT (%)	3.8
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	43.5	No	DWS Provided?	No
No	Landing Width (in)	42.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	2.3	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.6	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.4
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.4		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	Yes	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
				WATER METER LIP 0.5	N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 6850.00

