

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

| | | | |
|------------------------|--------------------------|-------------------------|------------------------|
| Intersection ID: 53281 | Main Street: BENFIELD_RD | Cross Street: I-485_RA | Location: SW |
| ADA ID: CF3F95E2A4DD | Ramp Type: Perp | Initial Pass/Fail: Pass | Overall Compliance: No |
| | | | Severity Score: 0 |

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

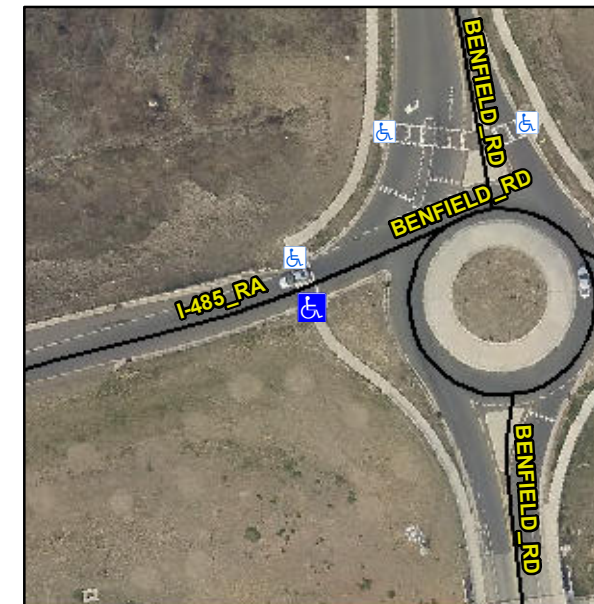

Possible Solutions:

Remove & Replace Landing. Gutter Ponding Observed.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para, R302.7

Total Cost: \$ 1000.00

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|--------|------------|-----------------------------|------|
| N/A | Ramp Length (in) | 98.0 | Yes | Ramp Slope (%) | 5.2 |
| Yes | Ramp Width (in) | 49.0 | Yes | Ramp XSlope (%) | 1.9 |
| N/A | Flare Type LT | Sloped | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | 7.6 | N/A | Flare Slope RT (%) | 3.8 |
| N/A | Flare Traversable LT? | No | N/A | Flare Traversable RT? | No |
| Yes | Landing Length (in) | 66.0 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 71.0 | Yes | DWS Contrast? | Yes |
| No | Landing Slope (%) | 4.4 | Yes | DWS Length (in) | 24.0 |
| Yes | Landing X Slope (%) | 0.3 | Yes | DWS Full Width? | Yes |
| N/A | Landing Curb? (Y/N) | No | Yes | DWS Offset (in) | 0.0 |
| N/A | Shared Landing? | No | | | |
| No | Gutter Ponding? | Yes | Yes | Gutter Slope (%) | 1.3 |
| Yes | Gutter Lip Ht (in) | 0.0 | Yes | Gutter X Slope (%) | 1.9 |
| N/A | Painted X Walk1? | Yes | N/A | Painted X Walk2? | N/A |
| | X Walk 1 Direction | To N | | X Walk 2 Direction | N/A |
| N/A | X Walk 1 Width (in) | 105.0 | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 1.1 | | X Walk 2 Slope (%) | N/A |
| | X Walk 1 X Slope (%) | 2.3 | | X Walk 2 X Slope (%) | N/A |
| Yes | Ramp inside XWalk1? | Yes | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | N/A | N/A | Clear Space? | Yes |
| | Road X Slope (%) | N/A | N/A | Clear Space to XWalk (in) | N/A |
| Yes | Any Obstructions? | No | Yes | Storm Grate/Utility Hazard? | No |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |

Street 1 Name I-485 RA
 Stop Condition-Street 2 None
 Street 2 Name N/A
 Stop Condition-Street 1 N/A

