

Access Compliance Report Public Rights-of-Way (Curb Ramps)



N/A

N/A

N/A


Good 7.0

Intersection ID: 30452 Main Street: CRESCENT_EXECUTIVE_DR Cross Street: GREEN_RIDGE_DR Location: SW

ADA ID: CF75CB221E36 Ramp Type: Combination2 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

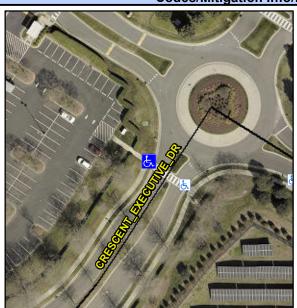

Street 1 Name

Stop Condition-Street 1

Street 2 Name

Stop Condition-Street 2

N/A

Possible Solutions:

Remove & Replace Entire Ramp.
Restripe Crosswalk.

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R304.2.2, R304.5.3

N/A N/A N/A Total Cost: \$ 1800.00 N/A

Compliance Description Data Compliance Description Data N/A Ramp Length RT (in) N/A Ramp Length LT (in) 59.0 N/A N/A Yes Ramp Width LT (in) 60.0 Ramp Width RT (in) N/A N/A Yes Ramp Slope LT (%) 7.5 Ramp Slope RT (%) N/A Ramp XSlope LT (%) N/A Ramp XSlope RT (%) Yes 1.0 N/A N/A Ramp Length (in) 48.0 Nο Ramp Slope (%) 8.5 96.0 No Ramp XSlope (%) 2.5 Yes Ramp Width (in) N/A Flare Type LT N/A N/A Flare Type RT N/A N/A N/A N/A Flare Slope LT (%) Flare Slope RT (%) N/A N/A Flare Traversable LT? N/A N/A Flare Traversable RT? N/A N/A Landing Length (in) N/A N/A DWS Provided? N/A N/A N/A **DWS Contrast?** N/A Landing Width (in) N/A N/A Landing Slope (%) N/A N/A DWS Length (in) N/A N/A Landing X Slope (%) N/A N/A DWS Full Width? N/A N/A Landing Curb? (Y/N) N/A N/A DWS Offset (in) N/A N/A Shared Landing? N/A N/A Gutter Ponding? N/A N/A Gutter Slope (%) N/A N/A N/A Gutter Lip Ht (in) N/A Gutter X Slope (%) N/A N/A N/A Painted X Walk1? Yes Painted X Walk2? N/A To SE N/A X Walk 1 Direction X Walk 2 Direction X Walk 1 Width (in) 76.0 X Walk 2 Width (in) N/A 3.8 N/A X Walk 1 Slope (%) X Walk 2 Slope (%) X Walk 1 X Slope (%) 1.6 X Walk 2 X Slope (%) N/A N/A Ramp inside XWalk1? No N/A Ramp inside XWalk2? N/A Road Slope (%) N/A Clear Space? N/A Road X Slope (%) N/A N/A Clear Space to XWalk (in) N/A N/A Any Obstruction? N/A **Obstruction Type**

N/A

Yes

Storm Grate/Utility Hazard?

Storm Grate/Utility Type

Surface Condition? (G/P)

Curb Slope (%)





