


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 13197	Main Street: S_MCDOWELL_ST	Cross Street: E_4TH_ST	Location: E
ADA ID: D038F0578A1F	Ramp Type: Directional	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

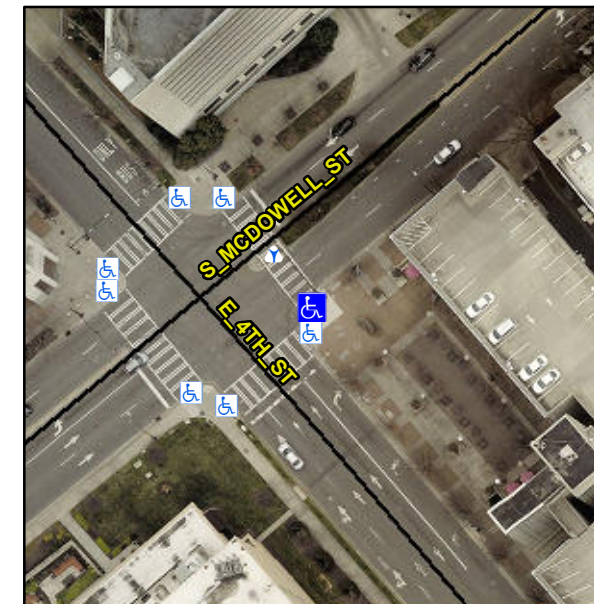

Possible Solutions:

**Remove & Replace Curbed Edge.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.2.3**

Total Cost:

\$ 300.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	45.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	51.0	Yes	Grade Break Slope (%)	4.7
Yes	Ramp Slope (%)	5.5	Yes	Grade Break XSlope (%)	1.2
Yes	Ramp XSlope (%)	0.6			
No	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	Yes	Flare Slope RT (%)	7.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	51.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.3	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	30.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	1.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.6
N/A	Painted X Walk1?	Yes		Road Slope (%)	0.8
	X Walk 1 Direction	To NW		Road X Slope (%)	2.7
	X Walk 1 Width (in)	150.0		Clear Space?	Yes
	X Walk 1 Slope (%)	0.8	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.7	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	1.4

