


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 45183	Main Street: WESTON_GLEN_DR	Cross Street: COMMUNITY_HOUSE_RD	Location: NE
ADA ID: D0872D3F0B8F	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 8.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

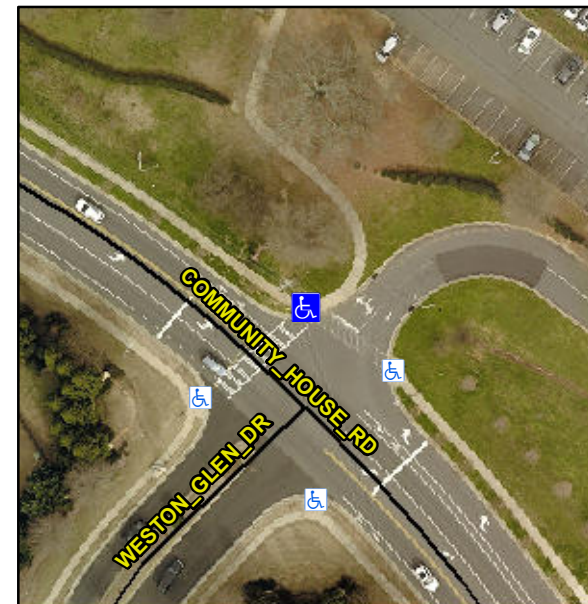

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Restripe Crosswalk.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1

Street 1 Name **COMMUNITY HOUSE RD**
 Stop Condition-Street 2 **Signal**
 Street 2 Name **WESTON GLEN DR**
 Stop Condition-Street 1 **StopSign**

Total Cost: \$ **3400.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	72.0	Yes	Ramp Slope (%)	7.0
No	Ramp Width (in)	41.5	Yes	Ramp XSlope (%)	0.9
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	112.0	N/A	X Walk 2 Width (in)	72.0
	X Walk 1 Slope (%)	3.0		X Walk 2 Slope (%)	0.4
	X Walk 1 X Slope (%)	1.4		X Walk 2 X Slope (%)	1.4
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	No
	Road Slope (%)	1.7	N/A	Clear Space?	N/A
	Road X Slope (%)	2.6	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes		Surface Condition? (G/P)	Good

