

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10040558	Main Street: W_8TH_ST	Cross Street: N/A	Location: E
ADA ID: D0B9091F1239	Ramp Type: Directional2	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

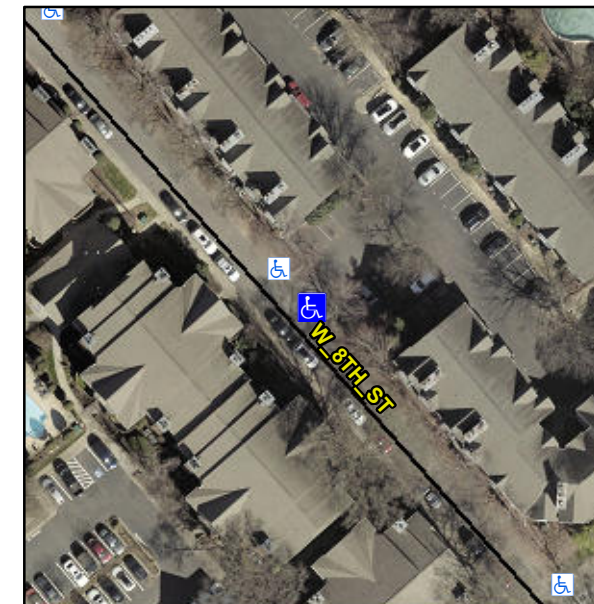

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3, R305**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	46.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	53.0	Yes	Grade Break Slope (%)	2.0
Yes	Ramp Slope (%)	4.8	Yes	Grade Break XSlope (%)	1.1
No	Ramp XSlope (%)	3.3			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	7.7
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	No	DWS Provided?	No
Yes	Landing Width (in)	59.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	0.1	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.2	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	No	N/A	DWS Offset RT (in)	N/A
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.8
N/A	Painted X Walk1?	No		Road Slope (%)	0.9
	X Walk 1 Direction	To NW		Road X Slope (%)	0.2
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	0.9	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.2	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	2.0

Total Cost: \$ 1800.00

