


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 6690	Main Street: NEVIN_RD	Cross Street: SPRING_TERRACE_LN	Location: W
ADA ID: D120BD1BB124	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.75	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

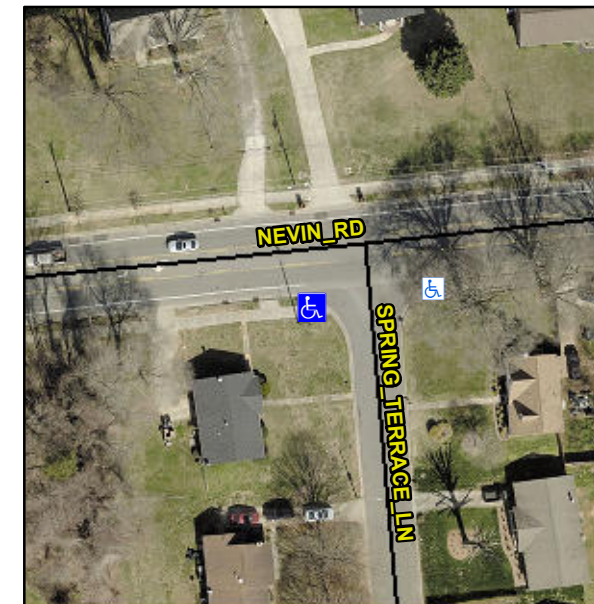

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305.1.4, R305.2

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	58.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	68.0	No	Grade Break Slope (%)	6.6
Yes	Ramp Slope (%)	7.8	Yes	Grade Break XSlope (%)	1.5
No	Ramp XSlope (%)	2.2			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	71.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.4	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.5	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	58.5
N/A	Shared Landing?	No	No	DWS Offset RT (in)	9.5
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.5
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.6
N/A	Painted X Walk1?	No		Road Slope (%)	0.1
	X Walk 1 Direction	To E		Road X Slope (%)	1.9
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	0.1	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.9	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	15.3

Street 1 Name **SPRING TERRACE LN**
 Stop Condition-Street 1 **StopSign**
 Street 2 Name **N/A**
 Stop Condition-Street 2 **N/A**

