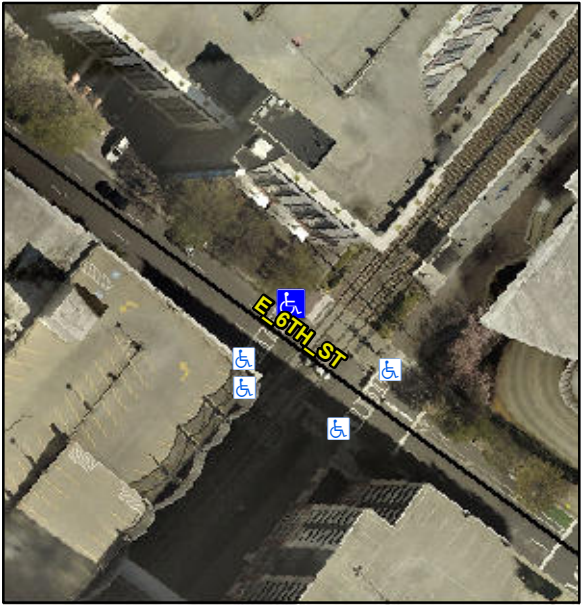


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

| | | | | |
|---------------------------|-----------------------|-------------------------|------------------------|-------------------|
| Intersection ID: 10025333 | Main Street: E_6TH_ST | Cross Street: N/A | Location: | N |
| ADA ID: D14C5DD18228 | Ramp Type: Perp | Initial Pass/Fail: Pass | Overall Compliance: No | Severity Score: 0 |

| Codes/Mitigation Info/Possible Solution | | Field Measurements/Component Compliance | | | | | |
|----------------------------------------------------------------------------------|-------------------------|------------------------------------------|-----------------------|--------|------------|-----------------------------|------|
|  | Possible Solutions: | Remove & Replace Entire Ramp. | | | | | |
| | Surveyor Notes: | N/A | | | | | |
| | PROW/ADA: | Not Found | | | | | |
| | Street 1 Name | E 6TH ST | | | | | |
| | Stop Condition-Street 2 | None | | | | | |
| | Street 2 Name | N/A | | | | | |
| | Stop Condition-Street 1 | N/A | | | | | |
| | Total Cost: | \$ 1850.00 | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | Compliance | Description | Data | Compliance | Description | Data |
| | | N/A | Ramp Length (in) | 38.0 | Yes | Ramp Slope (%) | 2.2 |
| | | Yes | Ramp Width (in) | 48.0 | Yes | Ramp XSlope (%) | 0.4 |
| | | N/A | Flare Type LT | Sloped | N/A | Flare Type RT | N/A |
| | | N/A | Flare Slope LT (%) | 8.4 | Yes | Flare Slope RT (%) | 2.4 |
| | | N/A | Flare Traversable LT? | Yes | N/A | Flare Traversable RT? | Yes |
| | | Yes | Landing Length (in) | 48.0 | Yes | DWS Provided? | Yes |
| | | Yes | Landing Width (in) | 48.0 | Yes | DWS Contrast? | Yes |
| | | Yes | Landing Slope (%) | 1.6 | Yes | DWS Length (in) | 24.0 |
| | | Yes | Landing X Slope (%) | 0.7 | Yes | DWS Full Width? | Yes |
| | | N/A | Landing Curb? (Y/N) | No | Yes | DWS Offset (in) | 0.0 |
| | | N/A | Shared Landing? | No | | | |
| | | Yes | Gutter Ponding? | No | Yes | Gutter Slope (%) | 2.6 |
| | | Yes | Gutter Lip Ht (in) | 0.0 | Yes | Gutter X Slope (%) | 0.5 |
| | | N/A | Painted X Walk1? | Yes | N/A | Painted X Walk2? | N/A |
| | | | X Walk 1 Direction | To W | | X Walk 2 Direction | N/A |
| | | N/A | X Walk 1 Width (in) | 112.0 | N/A | X Walk 2 Width (in) | N/A |
| | | | X Walk 1 Slope (%) | 0.3 | | X Walk 2 Slope (%) | N/A |
| | | | X Walk 1 X Slope (%) | 1.7 | | X Walk 2 X Slope (%) | N/A |
| | | Yes | Ramp inside XWalk1? | Yes | N/A | Ramp inside XWalk2? | N/A |
| | | | Road Slope (%) | N/A | N/A | Clear Space? | Yes |
| | | | Road X Slope (%) | N/A | N/A | Clear Space to XWalk (in) | N/A |
| | | Yes | Any Obstructions? | No | Yes | Storm Grate/Utility Hazard? | No |
| | | | Obstruction Type | | | Storm Grate/Utility Type | |
| | | | | | N/A | | N/A |
| | | | | | Yes | Surface Condition? (G/P) | Good |

