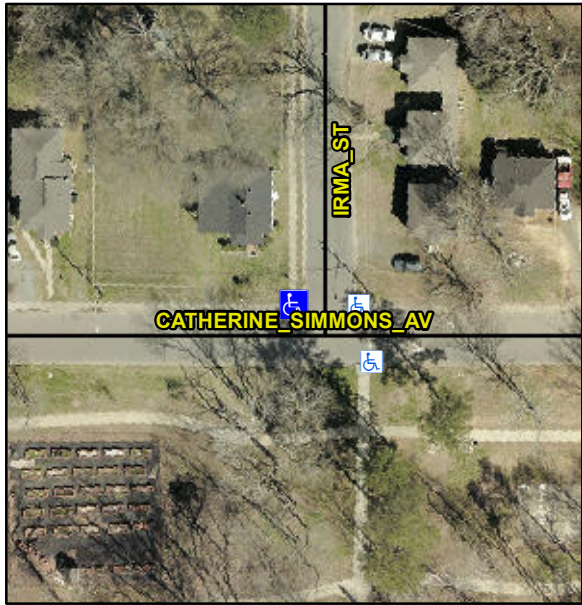


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 8303	Main Street: IRMA_ST	Cross Street: CATHERINE_SIMMONS_AV	Location: NW
ADA ID: D18AB4649A7B	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

		Possible Solutions:		Compliance		Description		Data	Compliance	Description		Data
		Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		59.5	No	Ramp Slope (%)		10.7
				No		Ramp Width (in)		25.0	No	Ramp XSlope (%)		5.0
				N/A		Flare Type LT		N/A	N/A	Flare Type RT		N/A
				N/A		Flare Slope LT (%)		N/A	N/A	Flare Slope RT (%)		N/A
				N/A		Flare Traversable LT?		N/A	N/A	Flare Traversable RT?		N/A
				N/A		Landing Length (in)		N/A	N/A	DWS Provided?		N/A
				N/A		Landing Width (in)		N/A	N/A	DWS Contrast?		N/A
				N/A		Landing Slope (%)		N/A	N/A	DWS Length (in)		N/A
				N/A		Landing X Slope (%)		N/A	N/A	DWS Full Width?		N/A
				N/A		Landing Curb? (Y/N)		N/A	N/A	DWS Offset (in)		N/A
				N/A		Shared Landing?		N/A				
				N/A		Gutter Ponding?		N/A	N/A	Gutter Slope (%)		N/A
				N/A		Gutter Lip Ht (in)		N/A	N/A	Gutter X Slope (%)		N/A
				N/A		Painted X Walk1?		No	N/A	Painted X Walk2?		N/A
						X Walk 1 Direction		To E		X Walk 2 Direction		N/A
				N/A		X Walk 1 Width (in)		N/A	N/A	X Walk 2 Width (in)		N/A
						X Walk 1 Slope (%)		0.0		X Walk 2 Slope (%)		N/A
						X Walk 1 X Slope (%)		5.4		X Walk 2 X Slope (%)		N/A
				N/A		Ramp inside XWalk1?		N/A	N/A	Ramp inside XWalk2?		N/A
						Road Slope (%)		N/A	N/A	Clear Space?		N/A
						Road X Slope (%)		N/A	N/A	Clear Space to XWalk (in)		N/A
				N/A		Any Obstructions?		N/A	N/A	Storm Grate/Utility Hazard?		N/A
						Obstruction Type				Storm Grate/Utility Type		
									N/A			N/A
									Yes	Surface Condition? (G/P)		Good

Street 1 Name	IRMA ST
Stop Condition-Street 2	StopSign
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost:	\$	1850.00
-------------	----	---------

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.2.2, R304.5.3

Total Cost: \$ 1850.00

