


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 51630Main Street:STEELECROFT_PYCross Street:CLOISTERS_CLUB_LNLocation:NEADA ID: D1CF5585587ARamp Type:Directional1Initial Pass/Fail:FailOverall Compliance:NoSeverity Score:1.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

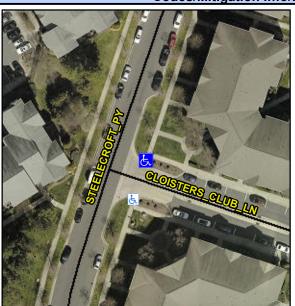

Street 1 Name
CLOISTER CLUB LN
Stop Condition-Street 1
StopSign
Street 2 Name
N/A
Stop Condition-Street 2
N/A

Possible Solutions:

Remove & Replace Entire Ramp.


Surveyor Notes:

N/A

PROW/ADA:

R304.5.3

Paraller and Baselutter Bate Organization Baselutter Bate						
	liance Description	Data	Compliance Description			Data
N/A	Ramp Length (in)	39.0	N/A	Grade Break?		N/A
Yes	Ramp Width (in)	60.0	N/A	Grade Break Slope (%)		0.0
es/	Ramp Slope (%)	0.9	N/A	Grade Break XSlope (%)		0.0
No	Ramp XSlope (%)	3.2				
N/A	Flare Type LT	N/A	N/A	Flare Type RT		N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	0.0
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A
N/A	Landing Length (in)	0.0	N/A	DWS	Provided?	N/A
N/A	Landing Width (in)	0.0	N/A	DWS	Contrast?	N/A
N/A	Landing Slope (%)	0.0	N/A	DWS	Length (in)	N/A
N/A	Landing X Slope (%)	0.0	N/A	DWS	Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset LT (in)	N/A
N/A	Shared Landing?	N/A	N/A	DWS	Offset RT (in)	N/A
N/A	Gutter Ponding?	0.0	N/A	Gutte	er Slope (%)	N/A
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutte	er X Slope (%)	N/A
N/A	Painted X Walk1?	No		Road	Slope (%)	1.2
	X Walk 1 Direction	To S		Road	X Slope (%)	1.4
	X Walk 1 Width (in)	N/A		Clea	Space?	N/A
	X Walk 1 Slope (%)	1.2	N/A	Clea	Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.4	N/A	Storr	n Grate/Utility Hazard?	N/A
N/A	Ramp inside XWalk1?	N/A		Storr	n Grate/Utility Type	
N/A	Any Obstructions?	N/A				N/A
	Obstruction Type		Yes	Surfa	ce Condition? (G/P)	Good
		N/A	N/A	Curb	Slope (%)	5.5
		,	-			

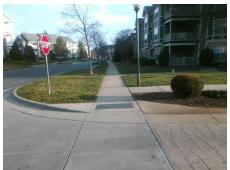



Total Cost:

