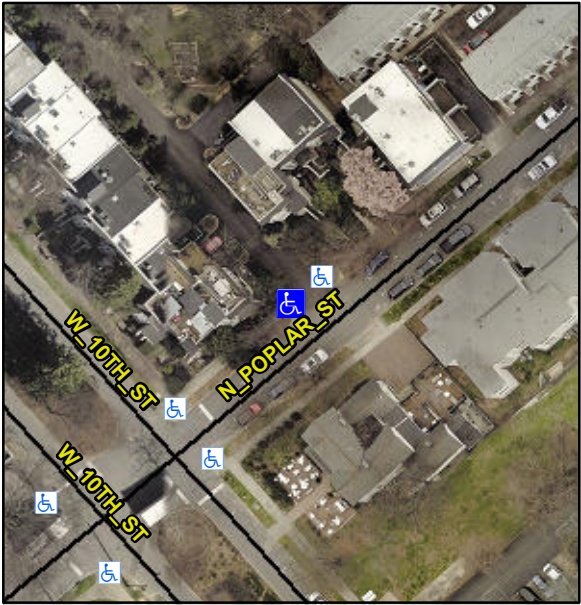


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10032717	Main Street: N_POPLAR_ST	Cross Street: N/A	Location: W
ADA ID: D26C15E2D011	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	51.0	N/A
			Yes	Ramp Width (in)	63.0	N/A
			No	Ramp Slope (%)	10.8	N/A
			No	Ramp XSlope (%)	2.8	N/A
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Flare Type RT	N/A	N/A
			N/A	Flare Slope RT (%)	N/A	N/A
<p>Surveyor Notes:</p> <p>N/A</p>			N/A	Flare Traversable RT?	N/A	N/A
			N/A	Landing Length (in)	0.0	N/A
			N/A	Landing Width (in)	0.0	N/A
			N/A	Landing Slope (%)	0.0	N/A
			N/A	Landing X Slope (%)	0.0	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	N/A
			N/A	Gutter Ponding?	0.0	N/A
			N/A	Gutter Lip Ht (in)	0.0	N/A
			N/A	Painted X Walk1?	No	N/A
<p>PROW/ADA:</p> <p>R304.2.2, R304.5.3</p>			N/A	X Walk 1 Direction	To NE	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A
			N/A	X Walk 1 Slope (%)	4.7	N/A
			N/A	X Walk 1 X Slope (%)	1.9	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A
			N/A	Any Obstructions?	N/A	N/A
			N/A	Obstruction Type		N/A
			Yes	Surface Condition? (G/P)		Good
			N/A	Curb Slope (%)		3.7
Street 1 Name	ENTRANCE					
Stop Condition-Street 1	StopSign					
Street 2 Name	N/A					
Stop Condition-Street 2	N/A					
Total Cost:	\$	1600.00				

