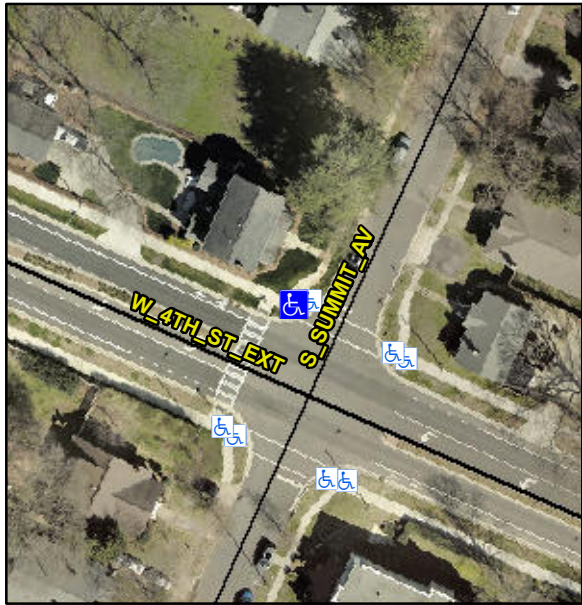


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11423	Main Street: S_SUMMIT_AV	Cross Street: W_4TH_ST_EXT	Location:	N
ADA ID: D2779C16F697	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance								
	Possible Solutions:	Remove & Replace Landing.			Compliance	Description	Data	Compliance	Description	Data
					N/A	Ramp Length (in)	79.0	Yes	Ramp Slope (%)	7.6
					Yes	Ramp Width (in)	70.0	Yes	Ramp XSlope (%)	1.8
					Yes	Flare Type L	Curbed_NoWalkSurface	Yes	Flare Type RT	N/A
					Yes	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
					N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
					Yes	Landing Length (in)	71.0	Yes	DWS Provided?	Yes
					Yes	Landing Width (in)	70.0	Yes	DWS Contrast?	Yes
					Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.0
					No	Landing X Slope (%)	3.1	Yes	DWS Full Width?	Yes
				N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5	
				N/A	Shared Landing?	No				
				Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.1	
				Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.2	
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
					X Walk 1 Direction	To SW		X Walk 2 Direction	N/A	
				N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
					X Walk 1 Slope (%)	2.4		X Walk 2 Slope (%)	N/A	
					X Walk 1 X Slope (%)	2.4		X Walk 2 X Slope (%)	N/A	
				N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
					Road Slope (%)	N/A	N/A	Clear Space?	Yes	
					Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
				Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
					Obstruction Type			Storm Grate/Utility Type		
							N/A			N/A
								Yes	Surface Condition? (G/P)	Good
Total Cost:			\$	500.00						

