

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 12958	Main Street: E_3RD_ST	Cross Street: S_DAVIDSON_ST	Location: E
ADA ID: D2F96F224A6D	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 7.5	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

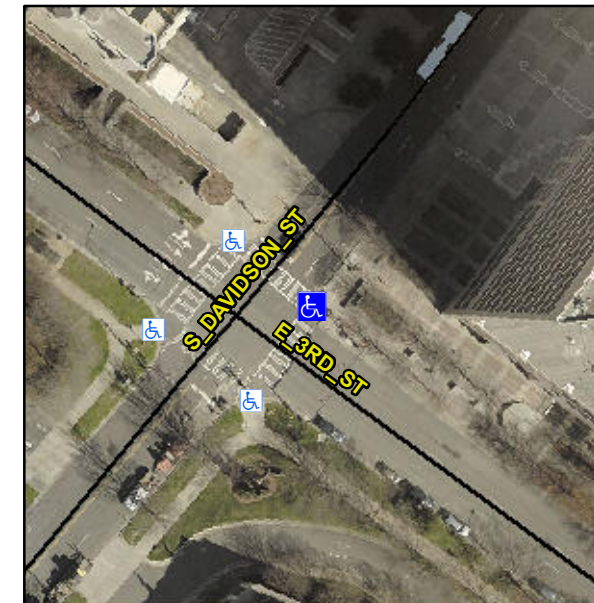

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3, R305.2, R302.7.2**

Total Cost: \$ 3400.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	82.0	Yes	Ramp Slope (%)	1.5
Yes	Ramp Width (in)	72.0	Yes	Ramp XSlope (%)	2.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	3.5	Yes	Flare Slope RT (%)	0.5
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.8	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	6.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.5
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.7
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	111.0	N/A	X Walk 2 Width (in)	108.0
	X Walk 1 Slope (%)	4.1		X Walk 2 Slope (%)	3.1
	X Walk 1 X Slope (%)	1.7		X Walk 2 X Slope (%)	1.2
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	1.2	N/A	Clear Space?	Yes
	Road X Slope (%)	4.8	Yes	Clear Space to XWalk (in)	64.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name S DAVIDSON ST  
 Stop Condition-Street 2 Signal  
 Street 2 Name E 3RD ST  
 Stop Condition-Street 1 Signal

