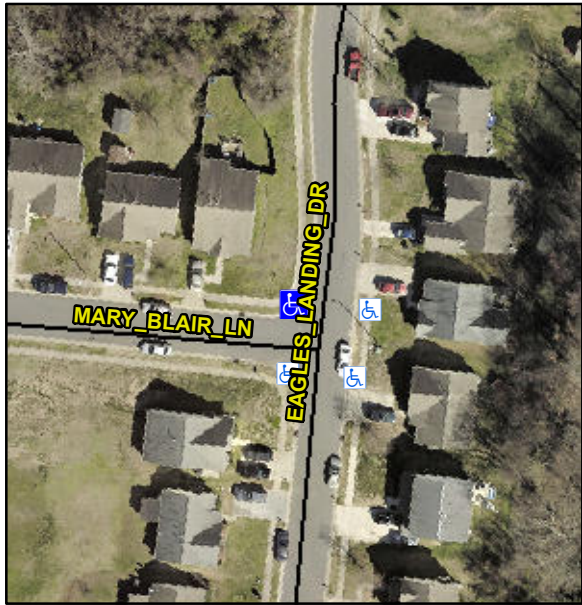


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 44701	Main Street: MARY_BLAIR_LN	Cross Street: EAGLES_LANDING_DR	Location:	N
ADA ID: D31A418F604B	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 33.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
 Street 1 Name MARY BLAIR LN Stop Condition-Street 2 StopSign Street 2 Name EAGLES LANDING DR Stop Condition-Street 1 None	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	47.0	Yes	Ramp Slope (%)	5.0
			No	Ramp Width (in)	47.5	No	Ramp XSlope (%)	8.2
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
PROW/ADA:			N/A	Shared Landing?	N/A			
Not Found, R304.5.1, R304.5.3			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	0.5	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To S		X Walk 2 Direction	To E
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	6.0		X Walk 2 Slope (%)	2.1
				X Walk 1 X Slope (%)	4.1		X Walk 2 X Slope (%)	7.6
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	6.7	N/A	Clear Space?	N/A
				Road X Slope (%)	4.2	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 3200.00						

