


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14980		Main Street: DILWORTH_RD_EAST		Cross Street: EAST_BV		Location: E					
ADA ID: D3373C0B01C8		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 12.5			
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance							
				Possible Solutions:		Compliance		Description		Data	
				Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		68.0	
Surveyor Notes:				N/A		Yes		Ramp Width (in)		59.0	
						Yes		Ramp Slope (%)		6.8	
PROW/ADA:				R304.5.3		No		Ramp XSlope (%)		6.4	
						N/A		Flare Type LT		N/A	
						N/A		Flare Slope LT (%)		N/A	
						N/A		Flare Traversable LT?		N/A	
						N/A		Landing Length (in)		0.0	
						N/A		Landing Width (in)		0.0	
						N/A		Landing Slope (%)		0.0	
						N/A		Landing X Slope (%)		0.0	
						N/A		Landing Curb? (Y/N)		N/A	
						N/A		Shared Landing?		N/A	
						N/A		Gutter Ponding?		0.0	
						N/A		Gutter Lip Ht (in)		0.0	
						N/A		Painted X Walk1?		Yes	
								X Walk 1 Direction		To NW	
								X Walk 1 Width (in)		105.0	
								X Walk 1 Slope (%)		6.8	
								X Walk 1 X Slope (%)		1.0	
						N/A		Ramp inside XWalk1?		Yes	
						N/A		Any Obstructions?		N/A	
								Obstruction Type		Yes	
								Surface Condition? (G/P)		Good	
						N/A		Curb Slope (%)		11.9	
Street 1 Name				DILWORTH RD EAST							
Stop Condition-Street 1				Signal							
Street 2 Name				N/A							
Stop Condition-Street 2				N/A							
Total Cost:				\$		1600.00					

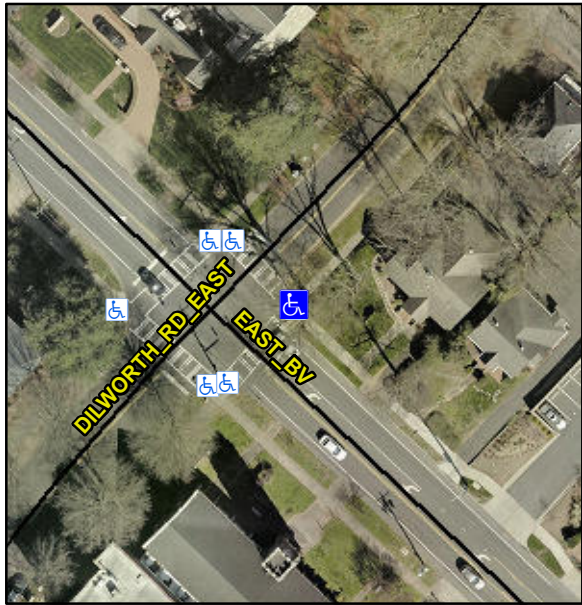