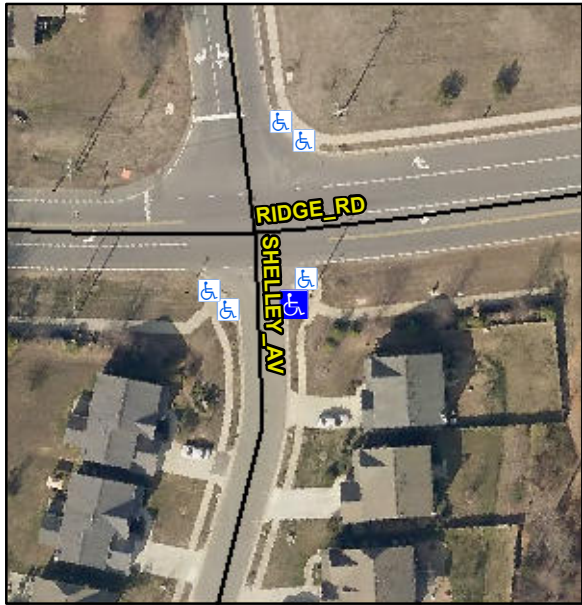


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 2905	Main Street: RIDGE_RD	Cross Street: SHELLEY_AV	Location: SE
ADA ID: D3C134ADD3A9	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 8.75	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance								
	Possible Solutions:		Compliance			Description			Data		
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)		130.0	Yes	Ramp Slope (%)		5.3	
			No	Ramp Width (in)		41.0	Yes	Ramp XSlope (%)		1.3	
			N/A	Flare Type LT		N/A	N/A	Flare Type RT		N/A	
			N/A	Flare Slope LT (%)		N/A	N/A	Flare Slope RT (%)		N/A	
			N/A	Flare Traversable LT?		N/A	N/A	Flare Traversable RT?		N/A	
			N/A	Landing Length (in)		N/A	N/A	DWS Provided?		N/A	
			N/A	Landing Width (in)		N/A	N/A	DWS Contrast?		N/A	
			N/A	Landing Slope (%)		N/A	N/A	DWS Length (in)		N/A	
			N/A	Landing X Slope (%)		N/A	N/A	DWS Full Width?		N/A	
Surveyor Notes:	N/A		N/A	Landing Curb? (Y/N)		N/A	N/A	DWS Offset (in)		N/A	
			N/A	Shared Landing?		N/A					
			N/A	Gutter Ponding?		N/A	N/A	Gutter Slope (%)		N/A	
			N/A	Gutter Lip Ht (in)		N/A	N/A	Gutter X Slope (%)		N/A	
			N/A	Painted X Walk1?		No	N/A	Painted X Walk2?		N/A	
				X Walk 1 Direction		To W		X Walk 2 Direction		N/A	
			N/A	X Walk 1 Width (in)		N/A	N/A	X Walk 2 Width (in)		N/A	
				X Walk 1 Slope (%)		2.8		X Walk 2 Slope (%)		N/A	
				X Walk 1 X Slope (%)		2.6		X Walk 2 X Slope (%)		N/A	
			N/A	Ramp inside XWalk1?		N/A	N/A	Ramp inside XWalk2?		N/A	
PROW/ADA:	R304.5.1			Road Slope (%)		N/A	N/A	Clear Space?		N/A	
				Road X Slope (%)		N/A	N/A	Clear Space to XWalk (in)		N/A	
			N/A	Any Obstructions?		N/A	N/A	Storm Grate/Utility Hazard?		N/A	
				Obstruction Type				Storm Grate/Utility Type			
							N/A			N/A	
							Yes	Surface Condition? (G/P)		Good	
	Total Cost:		\$ 1850.00								

