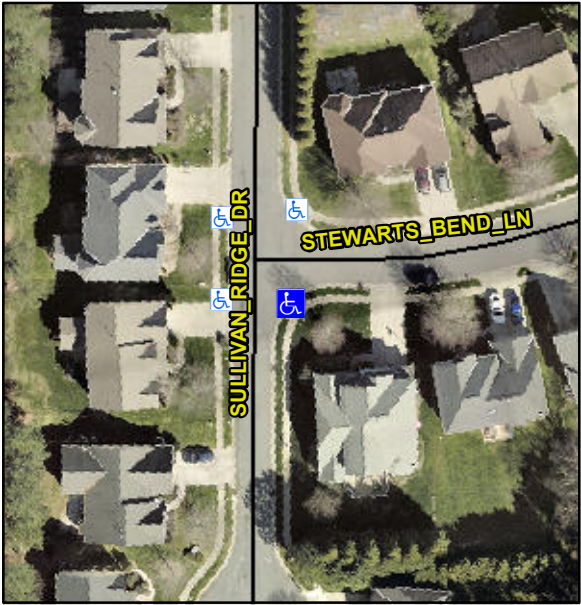


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 32294	Main Street: STEWARTS_BEND_LN	Cross Street: SULLIVAN_RIDGE_DR	Location: SE
ADA ID: D46702D0BD30	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 10			

	Possible Solutions:		Compliance		Description		Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	49.0	Yes	Ramp Slope (%)	7.5		
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.5.3</p>			No	Ramp Width (in)	46.0	No	Ramp XSlope (%)	4.9		
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
			N/A	Shared Landing?	N/A					
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No		
				X Walk 1 Direction	To N		X Walk 2 Direction	To W		
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
				X Walk 1 Slope (%)	3.9		X Walk 2 Slope (%)	2.3		
				X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	4.6		
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
				Road Slope (%)	1.5	N/A	Clear Space?	N/A		
				Road X Slope (%)	3.3	N/A	Clear Space to XWalk (in)	N/A		
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
				Obstruction Type			Storm Grate/Utility Type			
						N/A		N/A		
						Yes	Surface Condition? (G/P)	Good		

Total Cost: \$ 3200.00

