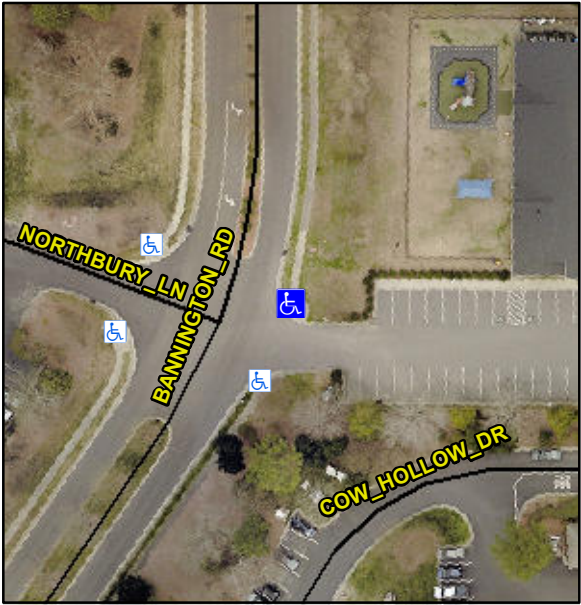


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28975	Main Street: BANNINGTON_RD	Cross Street: NORTHBURY_LN	Location: NE
ADA ID: D5064067E5A0	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 33.75	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Yes	Ramp Length (in)	108.5
			No	Ramp Width (in)	40.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p>N/A</p>			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			No	Painted X Walk1?	N/A
			To W	X Walk 1 Direction	To S
			N/A	X Walk 1 Width (in)	N/A
			3.4	X Walk 1 Slope (%)	4.8
			4.2	X Walk 1 X Slope (%)	7.6
			N/A	Ramp inside XWalk1?	N/A
<p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.5.3</p>			7.1	Road Slope (%)	N/A
			0.6	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 3200.00			

Street 1 Name	BANNINGTON RD
Stop Condition-Street 2	None
Street 2 Name	NORTHBURY LN
Stop Condition-Street 1	None

