


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 45694	Main Street: E_ARROWWOOD_RD	Cross Street: SILVER_ARROW_DR	Location: SW
ADA ID: D52572D75A75	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No Severity Score: 58.75

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:				
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	R304.5.1, R304.2.2, R304.5.3				
	Street 1 Name	SILVER ARROW DR			
	Stop Condition-Street 2	StopSign			
	Street 2 Name	E ARROWOOD RD			
	Stop Condition-Street 1	None			
Total Cost:		\$	3200.00		
Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	59.5	No	Ramp Slope (%)	12.2
No	Ramp Width (in)	42.0	No	Ramp XSlope (%)	12.3
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.2		X Walk 2 Slope (%)	9.0
	X Walk 1 X Slope (%)	10.3		X Walk 2 X Slope (%)	5.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	11.2	N/A	Clear Space?	N/A
	Road X Slope (%)	1.1	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

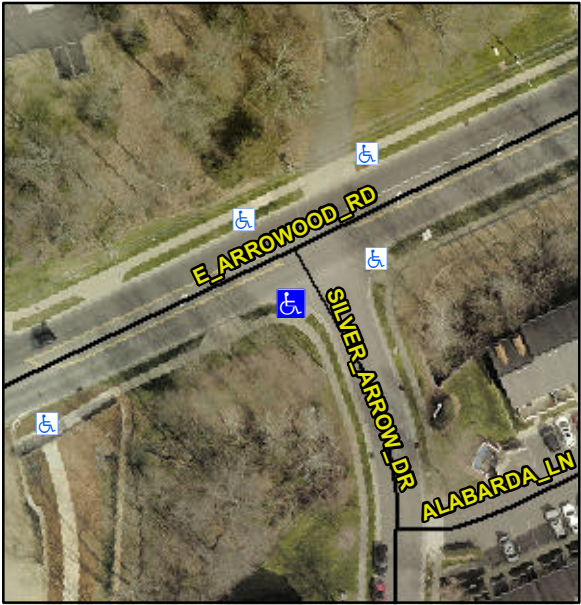