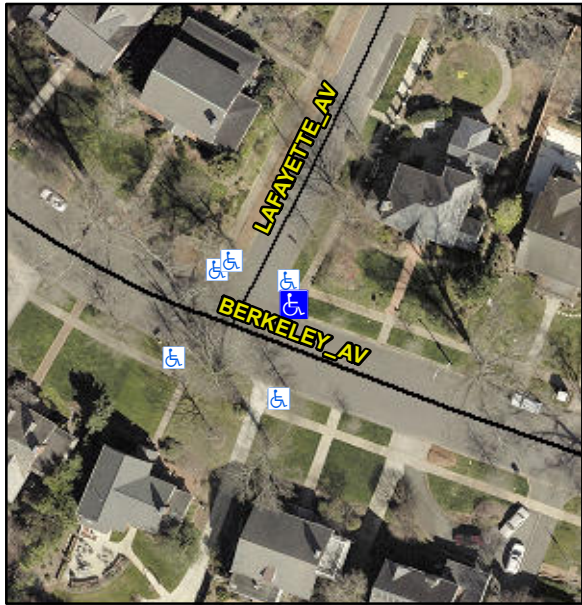


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 14258	Main Street: BERKELEY_AV	Cross Street: LAFAYETTE_AV	Location: NE
ADA ID: D53028DEF91F	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 16.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		<b>Compliance</b>			<b>Description</b>			<b>Data</b>	
	<b>Remove &amp; Replace Entire Ramp.</b>		N/A	Ramp Length (in)	74.0	N/A	Grade Break?	N/A		
			Yes	Ramp Width (in)	63.0	N/A	Grade Break Slope (%)	0.0		
			Yes	Ramp Slope (%)	7.1	N/A	Grade Break XSlope (%)	0.0		
			No	Ramp XSlope (%)	3.7					
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0		
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
			N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A		
			N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A		
		N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A			
		N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A			
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A			
		N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A			
		N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A			
		N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A			
		N/A	Painted X Walk1?	No		Road Slope (%)	4.0			
			X Walk 1 Direction	To S		Road X Slope (%)	1.3			
			X Walk 1 Width (in)	N/A		Clear Space?	N/A			
			X Walk 1 Slope (%)	4.0	N/A	Clear Space to XWalk (in)	N/A			
			X Walk 1 X Slope (%)	1.3	N/A	Storm Grate/Utility Hazard?	N/A			
		N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type				
		N/A	Any Obstructions?	N/A						
			Obstruction Type		No	Surface Condition? (G/P)	Poor			
					N/A	Curb Slope (%)	9.3			
		Total Cost:	\$	1600.00						
		Surveyor Notes:								
		<b>DAMAGED CURB/RAMP</b>								
		PROW/ADA:								
		<b>R304.5.3, R302.7</b>								

