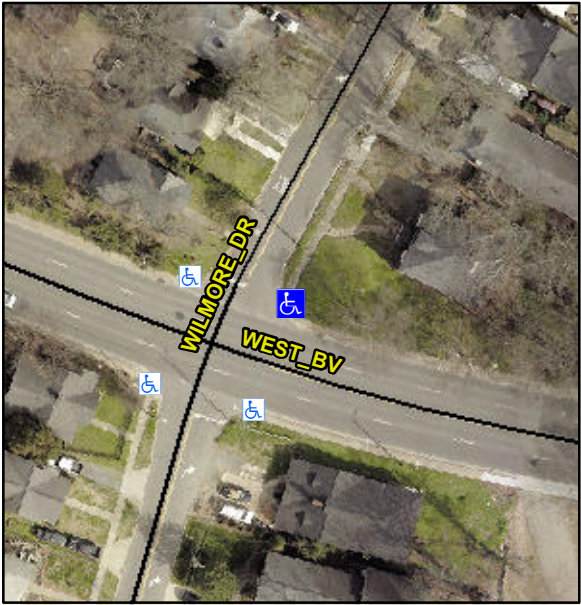


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13502	Main Street: WEST_BV	Cross Street: WILMORE_DR	Location: NE
ADA ID: D5E54883A406	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:						
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	Compliance	Description	Data	Compliance	Description	Data
<p>Surveyor Notes:</p> <p>N/A</p>	<p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.2.2, R304.5.3</p>	N/A	Ramp Length (in)	59.0	No	Ramp Slope (%)	10.1
		No	Ramp Width (in)	41.0	No	Ramp XSlope (%)	10.0
<p>Street 1 Name</p> <p>Stop Condition-Street 2</p> <p>Street 2 Name</p> <p>Stop Condition-Street 1</p>	<p>WILMORE DR</p> <p>StopSign</p> <p>WEST BV</p> <p>None</p>	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	4.1		X Walk 2 Slope (%)	11.7
			X Walk 1 X Slope (%)	7.2		X Walk 2 X Slope (%)	5.0
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	8.8	N/A	Clear Space?	N/A
			Road X Slope (%)	4.1	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
				N/A			N/A
					Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3200.00

