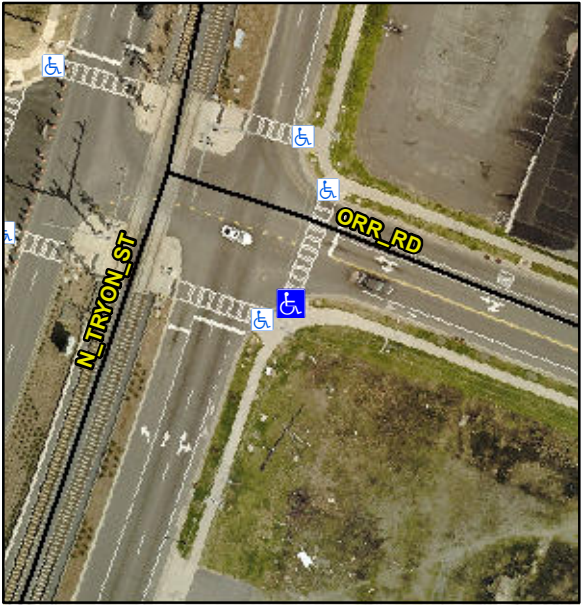


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8157	Main Street: N_TRYON_ST	Cross Street: ORR_RD	Location: SE
ADA ID: D5F5FE3CBBAC	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	Compliance
	Remove & Replace Entire Ramp.		Yes	Ramp Slope (%)	5.4	
			No	Ramp Width (in)	47.0	
			N/A	Flare Type LT	N/A	
			N/A	Flare Slope LT (%)	N/A	
			N/A	Flare Traversable LT?	N/A	
			N/A	Flare Traversable RT?	N/A	
			N/A	Landing Length (in)	N/A	
			N/A	Landing Width (in)	N/A	
			N/A	Landing Slope (%)	N/A	
Surveyor Notes: N/A PROW/ADA: R304.5.1, R304.5.3			N/A	Flare Type RT	N/A	
			N/A	Flare Slope RT (%)	N/A	
			N/A	DWS Provided?	N/A	
			N/A	DWS Contrast?	N/A	
			N/A	DWS Length (in)	N/A	
			N/A	DWS Full Width?	N/A	
			N/A	DWS Offset (in)	N/A	
			N/A	Gutter Ponding?	N/A	
			N/A	Gutter Lip Ht (in)	N/A	
			N/A	Painted X Walk1?	N/A	
Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1			Yes	Painted X Walk2?	N/A	
			To N	X Walk 2 Direction	N/A	
			N/A	X Walk 2 Width (in)	N/A	
			1.3	X Walk 2 Slope (%)	N/A	
			3.3	X Walk 2 X Slope (%)	N/A	
			Yes	Ramp inside XWalk2?	N/A	
			N/A	Clear Space?	N/A	
			N/A	Clear Space to XWalk (in)	N/A	
			N/A	Storm Grate/Utility Hazard?	N/A	
			N/A	Storm Grate/Utility Type	N/A	
Total Cost: \$ 1850.00			N/A	Surface Condition? (G/P)	Good	

