


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 31738	Main Street: LEAF_PLUM_DR	Cross Street: SAWLEAF_CT	Location: SW
ADA ID: D5F7287FE4F1	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 12.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

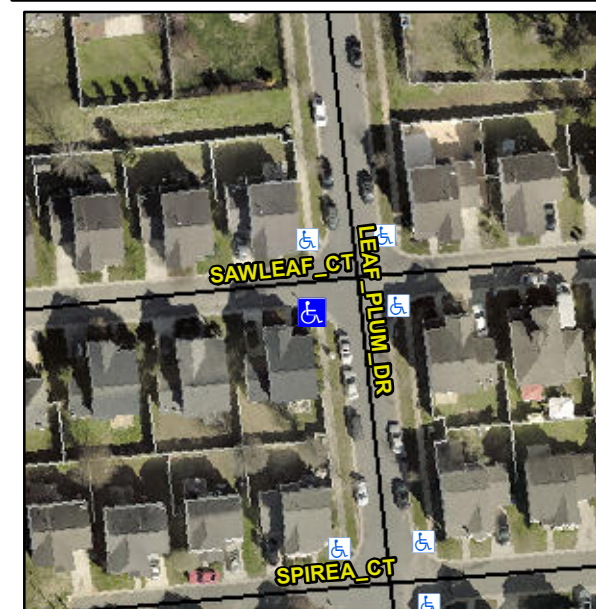

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.2, R302.7, R302.7.2, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	52.0	Yes	Ramp Slope (%)	5.5
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	5.2	N/A	Flare Slope RT (%)	2.2
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	38.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	49.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.7	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	1.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	Yes			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	9.5
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	1.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.1		X Walk 2 Slope (%)	7.8
	X Walk 1 X Slope (%)	3.9		X Walk 2 X Slope (%)	2.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.4	N/A	Clear Space?	Yes
	Road X Slope (%)	5.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes		Surface Condition? (G/P)	Good

