


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13408	Main Street: COMMONWEALTH_AV	Cross Street: THE_PLAZA	Location: S
ADA ID: D627E7D03CCD	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 10			

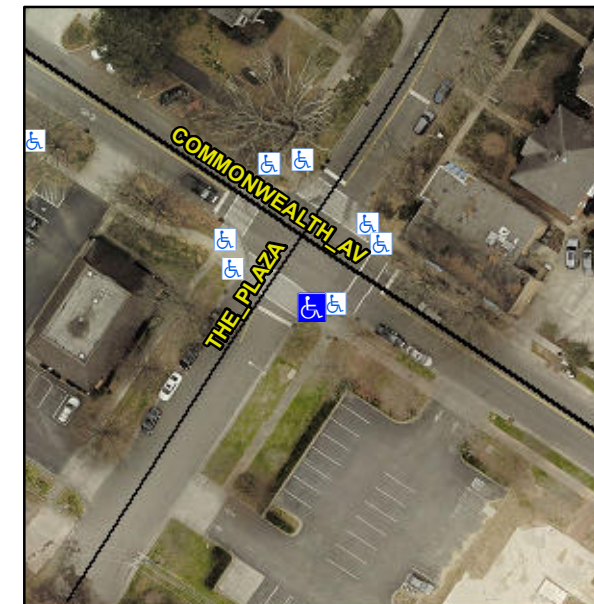

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

CURB GAP 1.0

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-
Para, R304.5.3, R305.1.4, R305.2,
R302.7.2**

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	99.5	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	58.0	No	Grade Break Slope (%)	7.6
Yes	Ramp Slope (%)	5.8	Yes	Grade Break XSlope (%)	1.9
Yes	Ramp XSlope (%)	1.4			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	70.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	67.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.1	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	4.7	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	3.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	33.5
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.6
No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	2.3
N/A	Painted X Walk1?	Yes		Road Slope (%)	4.1
	X Walk 1 Direction	To NW		Road X Slope (%)	3.4
	X Walk 1 Width (in)	135.0		Clear Space?	Yes
	X Walk 1 Slope (%)	4.1	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	3.4	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	21.7

