


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                                         |                                   |                                         |                        |
|-----------------------------------------|-----------------------------------|-----------------------------------------|------------------------|
| Intersection ID: N/A                    | Main Street: SUMMERFIELD RIDGE LN | Cross Street: LITTLE STREAM DR          | Location: NW           |
| ADA ID: D6422FAE9928                    | Ramp Type: BlendTrans1            | Initial Pass/Fail: Pass                 | Overall Compliance: No |
| Severity Score: 7.5                     |                                   |                                         |                        |
| Codes/Mitigation Info/Possible Solution |                                   | Field Measurements/Component Compliance |                        |

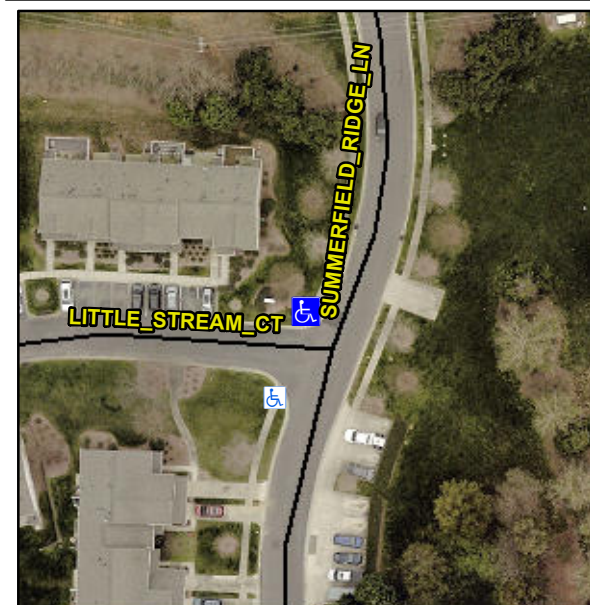

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**DAMAGED GTR**

PROW/ADA:

**R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2, R304.5.4, R304.5.3**

Total Cost: \$ 3950.00

| Compliance | Description           | Data   | Compliance | Description                 | Data   |
|------------|-----------------------|--------|------------|-----------------------------|--------|
| N/A        | Ramp Length (in)      | 50.5   | Yes        | BlendTrans Slope (%)        | 4.8    |
| Yes        | Ramp Width (in)       | 65.0   | Yes        | BlendTrans XSlope (%)       | 1.3    |
| N/A        | Flare Type LT         | Sloped | N/A        | Flare Type RT               | Sloped |
| N/A        | Flare Slope LT (%)    | 5.8    | N/A        | Flare Slope RT (%)          | 14.9   |
| N/A        | Flare Traversable LT? | No     | N/A        | Flare Traversable RT?       | No     |
| No         | Landing Length (in)   | 47.0   | Yes        | DWS Provided?               | Yes    |
| Yes        | Landing Width (in)    | 51.0   | Yes        | DWS Contrast?               | Yes    |
| No         | Landing Slope (%)     | 2.7    | Yes        | DWS Length (in)             | 24.0   |
| Yes        | Landing X Slope (%)   | 0.6    | No         | DWS Full Width?             | No     |
| N/A        | Landing Curb? (Y/N)   | No     | No         | DWS Offset (in)             | 5.5    |
| N/A        | Shared Landing?       | No     |            |                             |        |
| Yes        | Gutter Ponding?       | No     | No         | Gutter Slope (%)            | 9.9    |
| Yes        | Gutter Lip Ht (in)    | 0.0    | No         | Gutter X Slope (%)          | 2.1    |
| N/A        | Painted X Walk1?      | No     | N/A        | Painted X Walk2?            | No     |
|            | X Walk 1 Direction    | To S   |            | X Walk 2 Direction          | To E   |
|            | X Walk 1 Width (in)   | N/A    |            | X Walk 2 Width (in)         | N/A    |
|            | X Walk 1 Slope (%)    | 2.2    |            | X Walk 2 Slope (%)          | 5.0    |
|            | X Walk 1 X Slope (%)  | 3.5    |            | X Walk 2 X Slope (%)        | 0.1    |
| N/A        | Ramp inside XWalk1?   | N/A    | N/A        | Ramp inside XWalk2?         | N/A    |
|            | Road Slope (%)        | 2.1    |            | Clear Space?                | Yes    |
|            | Road X Slope (%)      | 2.8    | N/A        | Clear Space to XWalk (in)   | N/A    |
| Yes        | Any Obstructions?     | No     | Yes        | Storm Grate/Utility Hazard? | No     |
|            | Obstruction Type      |        |            | Storm Grate/Utility Type    |        |
|            |                       | N/A    |            |                             | N/A    |
|            |                       |        | Yes        | Surface Condition? (G/P)    | Good   |
|            |                       |        | Yes        | Curb Slope (%)              | 5.2    |

