

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 15466	Main Street: CHARLOTTE_DR	Cross Street: LEDGEWOOD_LN	Location: NE
ADA ID: D6719D271F5B	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 20	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

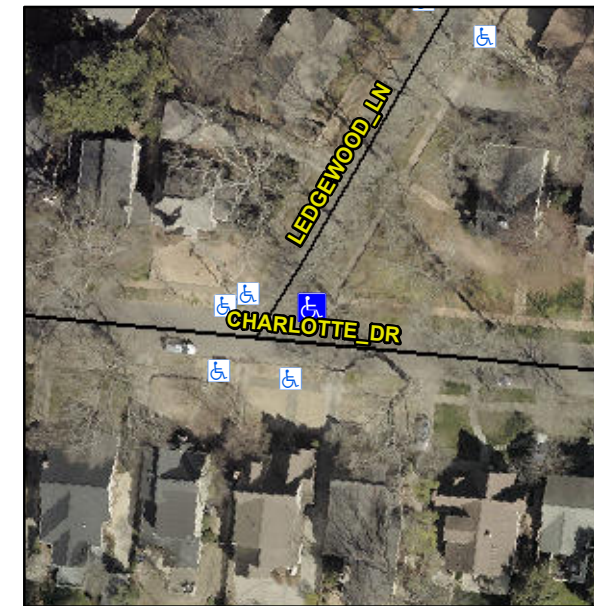

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.2.3, R305.2, R302.7, R302.7.2, R304.5.3

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	112.0	Yes	Ramp Slope (%)	7.7
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	13.3	Yes	Flare Slope RT (%)	9.6
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.1	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	No	DWS Offset (in)	3.5
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	0.4
No	Gutter Lip Ht (in)	1.5	No	Gutter X Slope (%)	3.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.1		X Walk 2 Slope (%)	3.7
	X Walk 1 X Slope (%)	3.1		X Walk 2 X Slope (%)	0.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.2	N/A	Clear Space?	Yes
	Road X Slope (%)	0.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name LEDGEWOOD LN
 Stop Condition-Street 2 StopSign
 Street 2 Name CHARLOTTE DR
 Stop Condition-Street 1 None

