


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 15287	Main Street: ALBEMARLE_RD	Cross Street: N_SHARON_AMITY_RD	Location: SW
ADA ID: D689B285E2B1	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

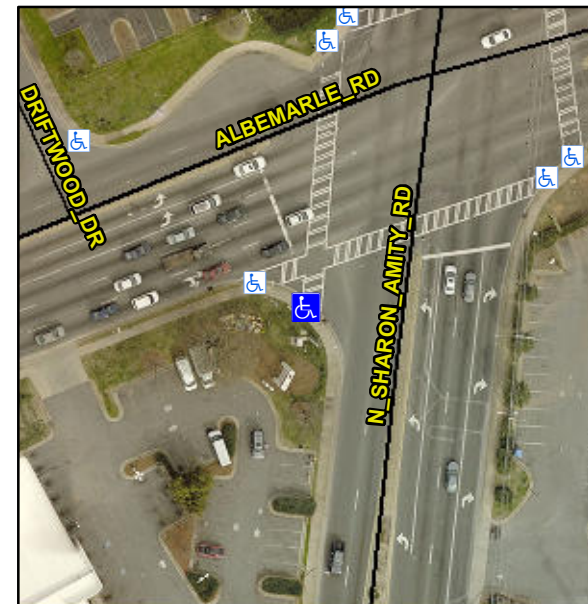

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

RT RP < 5%

PROW/ADA:

R304.3.2, R304.5.3

Street 1 Name	ALBEMARLE RD
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	65.5	N/A	Ramp Length RT (in)	57.5
Yes	Ramp Width LT (in)	65.0	Yes	Ramp Width RT (in)	65.5
No	Ramp Slope LT (%)	10.9	Yes	Ramp Slope RT (%)	1.9
No	Ramp XSlope LT (%)	3.6	No	Ramp XSlope RT (%)	3.9
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	110.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	24.6

