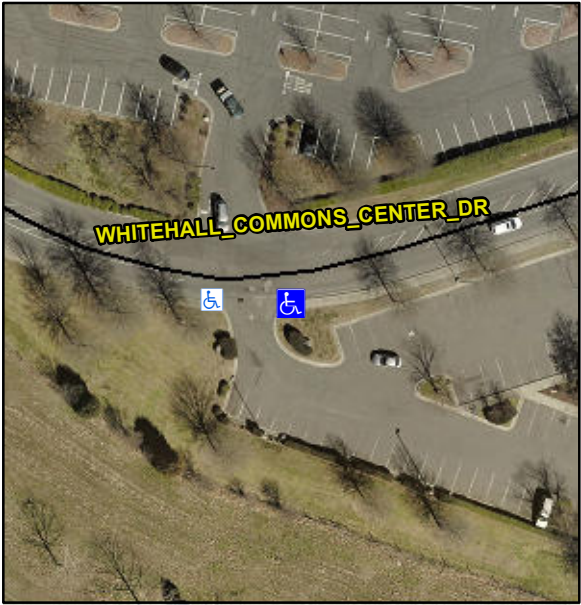


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: YORK_CENTER	Cross Street: N/A	Location: SE
ADA ID: D6DD48863E53	Ramp Type: Directional2	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
 <p>Street 1 Name WHITEHALL COMMONS CENTER DR</p> <p>Stop Condition-Street 1 None</p> <p>Street 2 Name N/A</p> <p>Stop Condition-Street 2 N/A</p>	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	62.0	N/A
			Yes	Ramp Width (in)	60.0	N/A
			No	Ramp Slope (%)	10.2	N/A
			Yes	Ramp XSlope (%)	4.9	N/A
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	0.0	N/A
			N/A	Landing Width (in)	0.0	N/A
			N/A	Landing Slope (%)	0.0	N/A
			N/A	Landing X Slope (%)	0.0	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	N/A
			N/A	Gutter Ponding?	0.0	N/A
			N/A	Gutter Lip Ht (in)	0.0	N/A
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To W	N/A
				X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	1.5	N/A
				X Walk 1 X Slope (%)	5.2	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.2.2</p>			N/A	Ramp inside XWalk1?	N/A	N/A
			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		N/A
Total Cost: \$ 1800.00						
			Yes	Surface Condition? (G/P)	Good	
			N/A	Curb Slope (%)	0.1	

