


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 42957	Main Street: PHEASANT_GLEN_RD	Cross Street: SPARROW_SPRINGS_LN	Location: NE
ADA ID: D7C98E454376	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

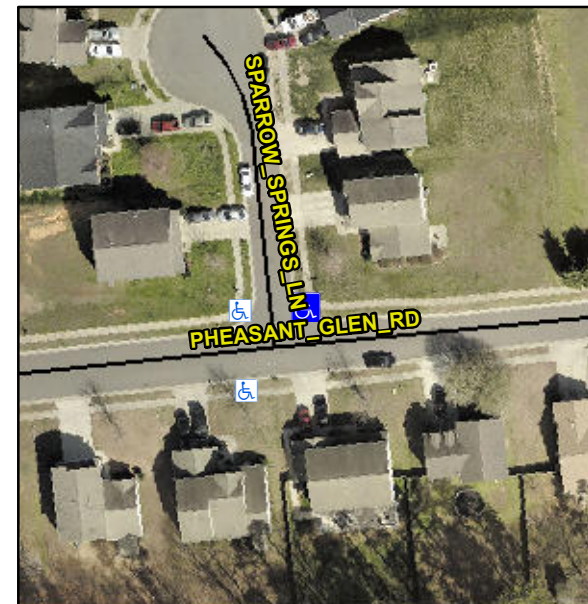

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3, R304.2.1, R305**

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.5	Yes	Ramp Slope (%)	6.0
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	2.7	Yes	Flare Slope RT (%)	3.8
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	45.5	No	DWS Provided?	No
Yes	Landing Width (in)	59.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.9	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.8	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.7
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.3		X Walk 2 Slope (%)	3.0
	X Walk 1 X Slope (%)	3.9		X Walk 2 X Slope (%)	3.5
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.5	N/A	Clear Space?	Yes
	Road X Slope (%)	5.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name	SPARROW SPRINGS LN
Stop Condition-Street 2	StopSign
Street 2 Name	PHEASANT GLEN RD
Stop Condition-Street 1	None

