

Access Compliance Report Public Rights-of-Way (Curb Ramps)



N/A

Good


Surface Condition? (G/P)

Intersection ID: 10041415 Main Street: WESTHALL_DR Cross Street: N/A Location: E

ADA ID: D834E9452250 Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 12.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

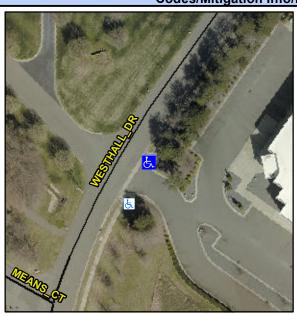

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

WESTHALL DR None ENTRANCE StopSign Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

Possible Solutions:

N/A

PROW/ADA:

Not Found, R304.5.3





Total Cost:



3200.00

rield Measurements/Component Compilance					
Compliance Description		Data	a Compliance Description		Data
N/A	Ramp Length (in)	108.0	Yes	Ramp Slope (%)	7.4
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	5.4
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.2		X Walk 2 Slope (%)	3.2
	X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	5.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.5	N/A	Clear Space?	N/A
	Road X Slope (%)	5.1	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type		l	Storm Grate/Utility Type	