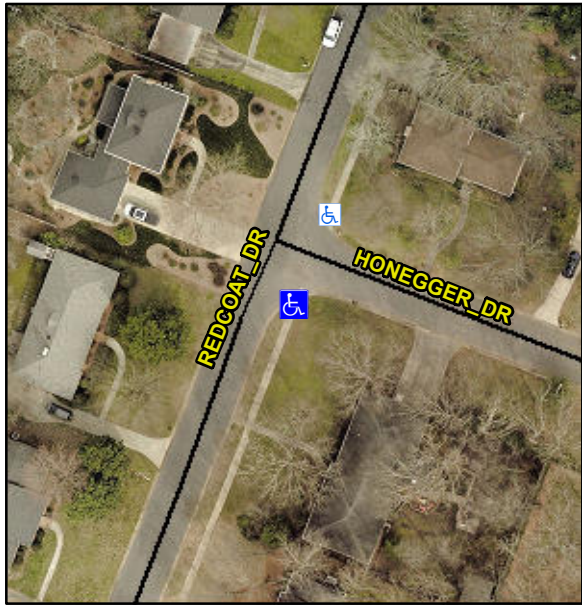


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 18881	Main Street: HONEGGER_DR	Cross Street: REDCOAT_DR	Location: SE
ADA ID: D863BC99ED1B	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance			Description			Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	68.0	N/A	Grade Break?	N/A		
			Yes	Ramp Width (in)	57.0	N/A	Grade Break Slope (%)	0.0		
			Yes	Ramp Slope (%)	7.1	N/A	Grade Break XSlope (%)	0.0		
			No	Ramp XSlope (%)	5.5					
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0		
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
			N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A		
			N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A		
Surveyor Notes: N/A			N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A		
			N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A		
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A		
			N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A		
			N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A		
			N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A		
			N/A	Painted X Walk1?	No		Road Slope (%)	2.4		
				X Walk 1 Direction	To NE		Road X Slope (%)	1.2		
				X Walk 1 Width (in)	N/A		Clear Space?	N/A		
				X Walk 1 Slope (%)	2.4	N/A	Clear Space to XWalk (in)	N/A		
PROW/ADA: R304.5.3				X Walk 1 X Slope (%)	1.2	N/A	Storm Grate/Utility Hazard?	N/A		
			N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type			
			N/A	Any Obstructions?	N/A			N/A		
				Obstruction Type		Yes	Surface Condition? (G/P)	Good		
					N/A	N/A	Curb Slope (%)	8.3		
	Total Cost:		\$	1600.00						

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3

Total Cost:

\$ 1600.00

